


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 29119	Main Street: CRISP_WOOD_LN	Cross Street: HIGHLAND_PARK_DR	Location: S
ADA ID: 9A2DF6CD6885	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 6.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

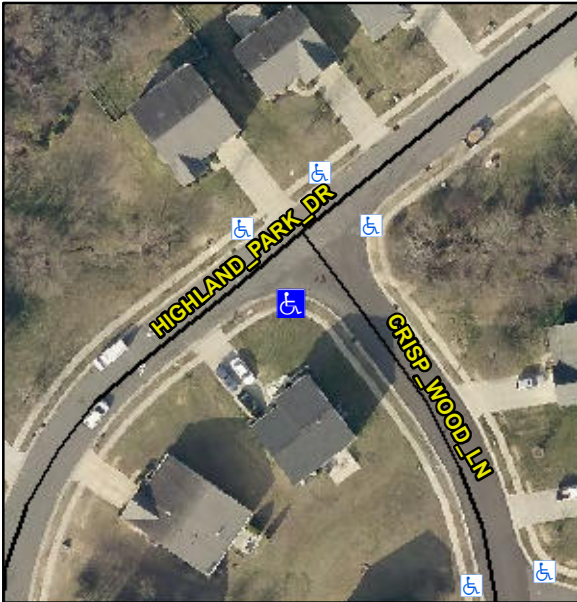

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4

Street 1 Name: **CRISP WOOD LN**
 Stop Condition-Street 2: **StopSign**
 Street 2 Name: **HIGHLAND PARK DR**
 Stop Condition-Street 1: **None**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	47.0	Yes	Ramp Slope (%)	5.4
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.5	Yes	Flare Slope RT (%)	0.3
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	46.5	Yes	DWS Provided?	Yes
No	Landing Width (in)	47.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.1	No	DWS Length (in)	23.0
No	Landing X Slope (%)	3.3	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.8		X Walk 2 Slope (%)	0.5
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	2.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.5	N/A	Clear Space?	Yes
	Road X Slope (%)	1.7	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

