


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30060	Main Street: DILLARD RIDGE DR	Cross Street: WATERS TRAIL DR	Location:	N
ADA ID: 9A3F938CAE77	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

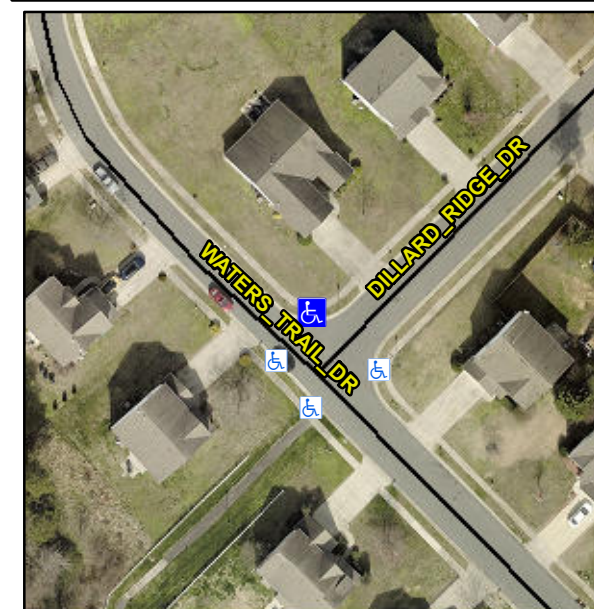

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

CURB GAP 1.0, RAMP LIP 1.0, CURB WIDTH 31.0

PROW/ADA:

Not Found, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	97.0	Yes	BlendTrans Slope (%)	3.8
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.7
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.3		X Walk 2 Slope (%)	0.8
	X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	2.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.6		Clear Space?	Yes
	Road X Slope (%)	5.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	22.1

Street 1 Name **WATERS TRAIL DR**
 Stop Condition-Street 1 **None**
 Street 2 Name **DILLARD RIDGE DR**
 Stop Condition-Street 2 **StopSign**

