


Intersection ID: 47279	Main Street: SAVANNAH_HILLS_DR	Cross Street: CARRINGTON_FOREST_LN	Location:	NW
ADA ID: 9A433A8E31D8	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
<p>1. Code 100: No visible signs of distress or damage.</p> <p>2. Code 200: Minor surface cracking or staining.</p> <p>3. Code 300: Moderate surface cracking or staining.</p> <p>4. Code 400: Severe surface cracking or staining.</p> <p>5. Code 500: Structural damage or failure.</p>	<p>1. Field Measurements: Measure the length, width, and depth of any cracks or stains.</p> <p>2. Component Compliance: Verify that all components meet the required specifications and standards.</p>

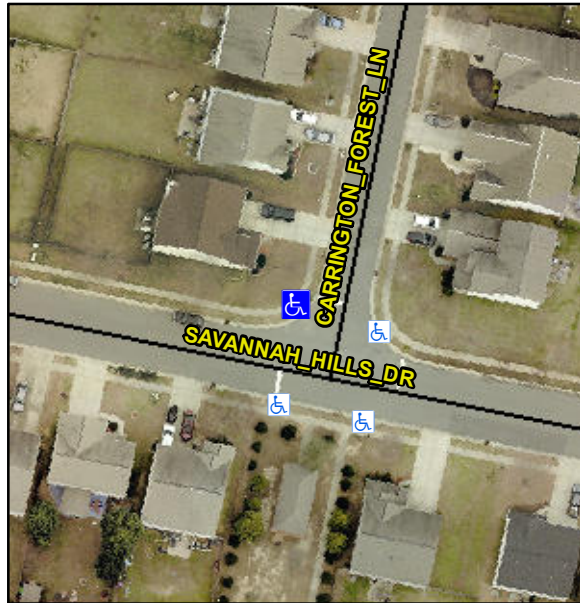

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.2
No	Ramp Width (in)	46.0	Yes	Ramp XSlope (%)	0.9
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	1.7
	X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	0.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.3	N/A	Clear Space?	N/A
	Road X Slope (%)	1.0	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

Street 1 Name	SAVANNAH HILLS DR
Stop Condition-Street 2	None
Street 2 Name	CARRINGTON FOREST LN
Stop Condition-Street 1	StopSign

