

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11262	Main Street: SHAMROCK_DR	Cross Street: EASTWAY_DR	Location: SE
ADA ID: 9B4A351693D1	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.75	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

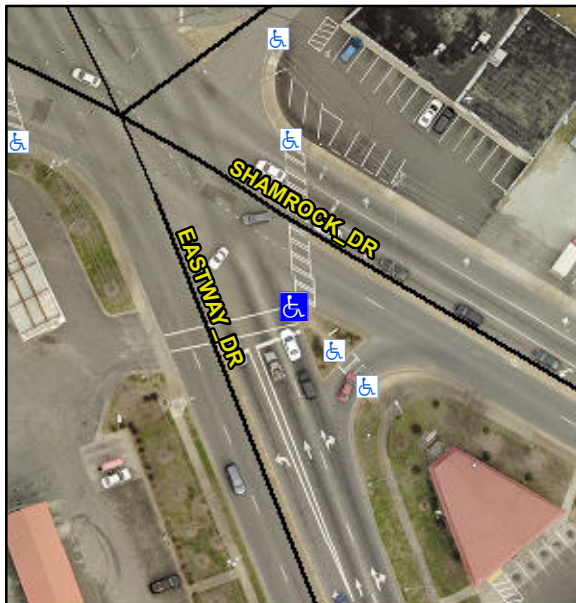

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk(s) To Provide Clear space.

Surveyor Notes:

LOCATED ON ISLAND

PROW/ADA:

Not Found, R305.1.4

Street 1 Name **SHAMROCK DR**
 Stop Condition-Street 1 **Signal**
 Street 2 Name **EASTWAY DR**
 Stop Condition-Street 2 **Signal**

Total Cost: \$ **3700.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	95.0	Yes	BlendTrans Slope (%)	3.7
Yes	Ramp Width (in)	58.0	Yes	BlendTrans XSlope (%)	2.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	2.7	N/A	Flare Slope RT (%)	6.7
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	57.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	59.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.5	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	3.6	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
	X Walk 1 Width (in)	108.0		X Walk 2 Width (in)	111.0
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	4.1
	X Walk 1 X Slope (%)	4.0		X Walk 2 X Slope (%)	1.3
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	4.3		Clear Space?	Yes
	Road X Slope (%)	4.3	No	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	21.5

