

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

| | | | |
|------------------------|-----------------------------|--------------------------|------------------------|
| Intersection ID: 43133 | Main Street: STATESVILLE_AV | Cross Street: CARMINE_ST | Location: W |
| ADA ID: 9BB469FCC7BE | Ramp Type: ParaDiag | Initial Pass/Fail: Fail | Overall Compliance: No |
| | | | Severity Score: 13.75 |

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

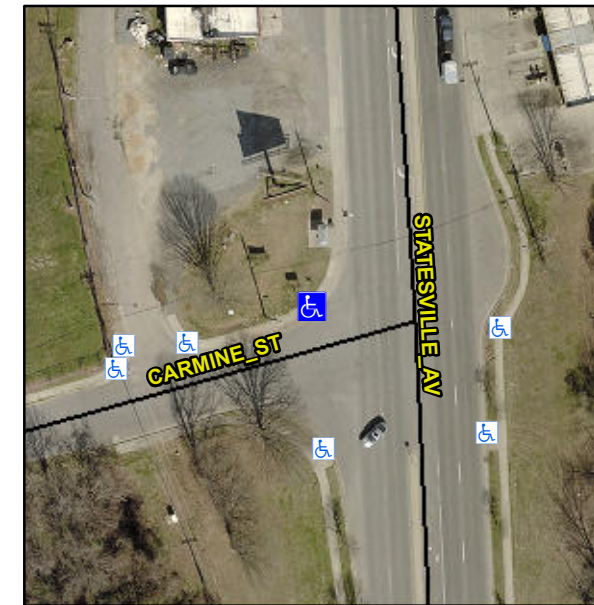

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.3.2

Total Cost: \$ 3200.00

| Compliance | Description | Data | Compliance | Description | Data |
|------------|----------------------|-------|------------|-----------------------------|-------|
| N/A | Ramp Length LT (in) | 64.0 | N/A | Ramp Length RT (in) | 60.0 |
| Yes | Ramp Width LT (in) | 60.0 | Yes | Ramp Width RT (in) | 60.0 |
| Yes | Ramp Slope LT (%) | 7.4 | No | Ramp Slope RT (%) | 8.7 |
| No | Ramp XSlope LT (%) | 3.6 | Yes | Ramp XSlope RT (%) | 1.7 |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | X Walk 1 Direction | To SE | | X Walk 2 Direction | To NE |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 0.2 | | X Walk 2 Slope (%) | 0.6 |
| | X Walk 1 X Slope (%) | 0.5 | | X Walk 2 X Slope (%) | 0.9 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 0.6 | N/A | Clear Space? | N/A |
| | Road X Slope (%) | 0.5 | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | N/A | Curb Slope (%) | 18.8 |

Street 1 Name CARMINE ST
 Stop Condition-Street 1 StopSign
 Street 2 Name STATESVILLE AV
 Stop Condition-Street 2 None

