


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11055	Main Street: MATHESON_AV	Cross Street: THE_PLAZA	Location: E
ADA ID: 9BF654BBCBCE	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 15.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

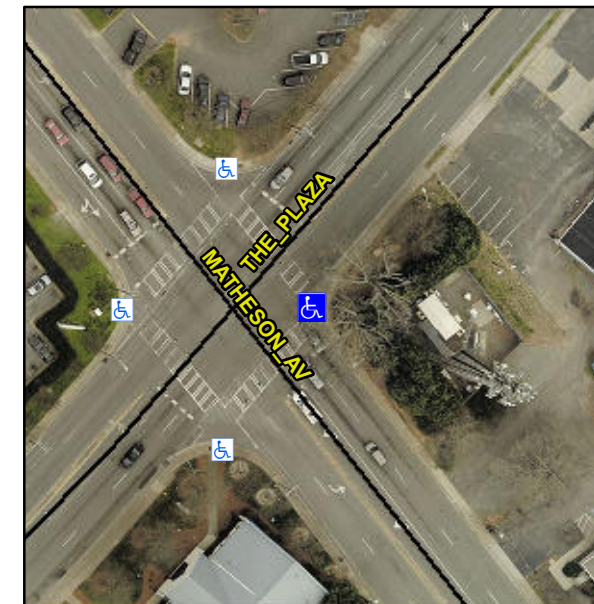

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk(s) To Provide Clear space. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305.1.4, R305.2, R302.7.2, R304.5.4

Total Cost: \$ 4450.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	65.5	Yes	BlendTrans Slope (%)	1.9
Yes	Ramp Width (in)	76.0	No	BlendTrans XSlope (%)	4.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.0	N/A	Flare Slope RT (%)	6.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	9.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.8
No	Gutter Lip Ht (in)	0.3	No	Gutter X Slope (%)	2.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
	X Walk 1 Width (in)	110.0		X Walk 2 Width (in)	110.0
	X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	3.1
	X Walk 1 X Slope (%)	3.4		X Walk 2 X Slope (%)	1.7
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.8		Clear Space?	Yes
	Road X Slope (%)	2.2	No	Clear Space to XWalk (in)	24.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	25.3

