

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 11891	Main Street: N_POPLAR_ST	Cross Street: W_6TH_ST	Location: W
ADA ID: 9CCA33CCE255	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

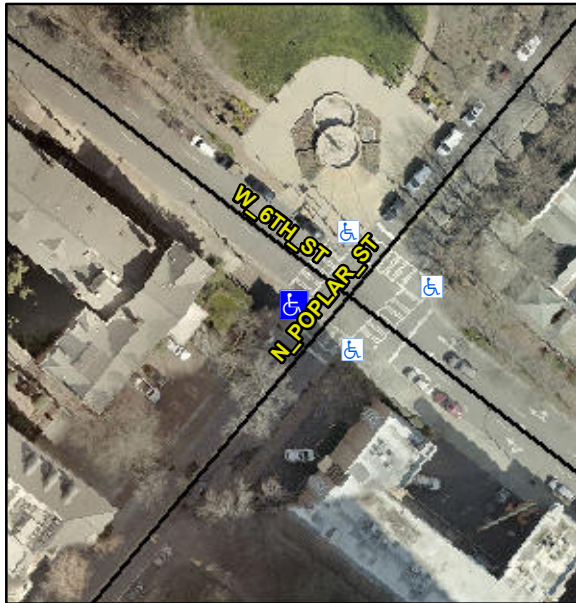

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk(s) To Provide Clear space. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.3, R305**

Street 1 Name **N POPLAR ST**  
 Stop Condition-Street 2 **Signal**  
 Street 2 Name **W 6TH ST**  
 Stop Condition-Street 1 **Signal**

Total Cost: \$ **4450.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	104.0	Yes	Ramp Slope (%)	6.6
Yes	Ramp Width (in)	49.0	No	Ramp XSlope (%)	3.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.3	Yes	Flare Slope RT (%)	2.8
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	No	DWS Provided?	No
Yes	Landing Width (in)	60.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.2	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	4.3	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.9
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.5
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	137.0	N/A	X Walk 2 Width (in)	137.0
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	1.0
	X Walk 1 X Slope (%)	3.7		X Walk 2 X Slope (%)	1.0
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.2	N/A	Clear Space?	Yes
	Road X Slope (%)	3.2	No	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

