

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14213	Main Street: CENTRAL_AV	Cross Street: ROSEHAVEN_DR	Location: SW
ADA ID: 9D1719E99BC5	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

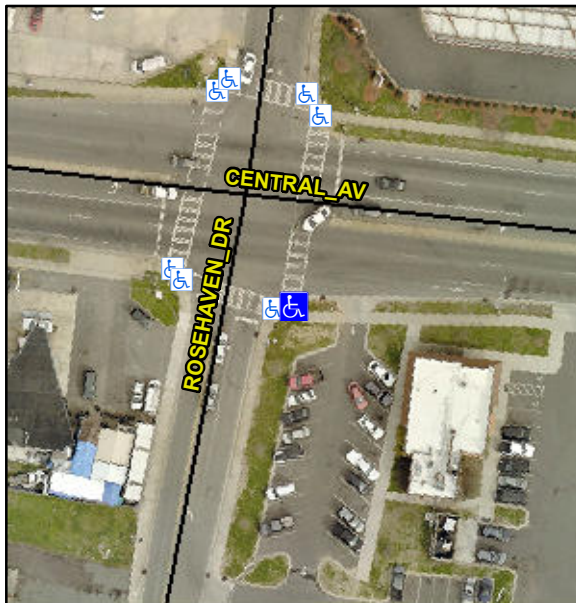

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.5.3, R304.2.1,
R304.2.2-Perp, R304.3.2-Para, R305**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	70.5	Yes	Ramp Slope (%)	6.2
Yes	Ramp Width (in)	49.0	No	Ramp XSlope (%)	4.5
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
No	Landing Length (in)	45.0	No	DWS Provided?	No
Yes	Landing Width (in)	73.5	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.3	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.0	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	108.5	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 2600.00

