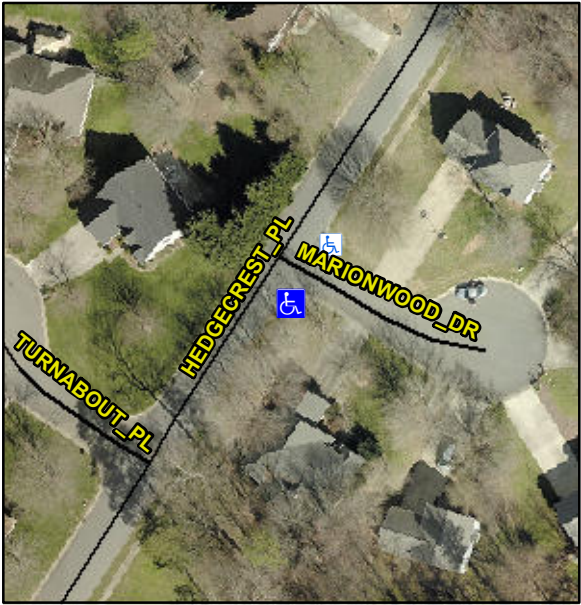


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 4883	Main Street: HEDGECREST_PL	Cross Street: MARIONWOOD_DR	Location:	S
ADA ID: 9D39BC9D9096	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 37.5

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:	<b>Remove &amp; Replace Entire Ramp.</b>					
	Surveyor Notes:	N/A					
	PROW/ADA:	Not Found, R304.2.2, R304.5.3					
	Street 1 Name	MARIONWOOD DR					
	Stop Condition-Street 2	StopSign					
	Street 2 Name	N/A					
	Stop Condition-Street 1	N/A					
	Total Cost:	\$ 1850.00					
		Compliance	Description	Data	Compliance	Description	Data
		N/A	Ramp Length (in)	48.0	No	Ramp Slope (%)	8.6
		Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	7.8
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
			X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	7.1		X Walk 2 X Slope (%)	N/A
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A	N/A	Clear Space?	N/A
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
				N/A			N/A
					Yes	Surface Condition? (G/P)	Good

