


## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: 29916 Main Street: NORTHRIDGE DR **Cross Street: WILDBROOK DR** Location: ADA ID: 9D88317B66AB Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No** Severity Score: 21.25

**Codes/Mitigation Info/Possible Solution** 

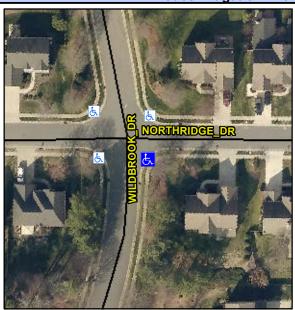

Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1 **NORTHRIDGE DR** StopSign **WILDBROOK DR** None

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

Possible Solutions:

N/A

PROW/ADA:

R304.5.1, R304.5.3

|    | Darg I |  |
|----|--------|--|
|    |        |  |
|    |        |  |
| 1. |        |  |



Total Cost:



3200.00

| Field Measurements/Component Compliance |                       |      |      |                             |      |  |
|---|-----------------------|------|------|-----------------------------|------|--|
| Comp                                    | liance Description    | Data | Comp | liance Description          | Data |  |
| N/A                                     | Ramp Length (in)      | 48.0 | Yes  | Ramp Slope (%)              | 6.9  |  |
| No                                      | Ramp Width (in)       | 40.0 | No   | Ramp XSlope (%)             | 5.2  |  |
| N/A                                     | Flare Type LT         | N/A  | N/A  | Flare Type RT               | N/A  |  |
| N/A                                     | Flare Slope LT (%)    | N/A  | N/A  | Flare Slope RT (%)          | N/A  |  |
| N/A                                     | Flare Traversable LT? | N/A  | N/A  | Flare Traversable RT?       | N/A  |  |
| N/A                                     | Landing Length (in)   | N/A  | N/A  | DWS Provided?               | N/A  |  |
| N/A                                     | Landing Width (in)    | N/A  | N/A  | DWS Contrast?               | N/A  |  |
| N/A                                     | Landing Slope (%)     | N/A  | N/A  | DWS Length (in)             | N/A  |  |
| N/A                                     | Landing X Slope (%)   | N/A  | N/A  | DWS Full Width?             | N/A  |  |
| N/A                                     | Landing Curb? (Y/N)   | N/A  | N/A  | DWS Offset (in)             | N/A  |  |
| N/A                                     | Shared Landing?       | N/A  |      |                             |      |  |
| N/A                                     | Gutter Ponding?       | N/A  | N/A  | Gutter Slope (%)            | N/A  |  |
| N/A                                     | Gutter Lip Ht (in)    | N/A  | N/A  | Gutter X Slope (%)          | N/A  |  |
| N/A                                     | Painted X Walk1?      | No   | N/A  | Painted X Walk2?            | No   |  |
|   | X Walk 1 Direction    | To N |      | X Walk 2 Direction          | To W |  |
| N/A                                     | X Walk 1 Width (in)   | N/A  | N/A  | X Walk 2 Width (in)         | N/A  |  |
|   | X Walk 1 Slope (%)    | 7.7  |      | X Walk 2 Slope (%)          | 2.6  |  |
|   | X Walk 1 X Slope (%)  | 0.1  |      | X Walk 2 X Slope (%)        | 6.1  |  |
| N/A                                     | Ramp inside XWalk1?   | N/A  | N/A  | Ramp inside XWalk2?         | N/A  |  |
|   | Road Slope (%)        | 3.9  | N/A  | Clear Space?                | N/A  |  |
|   | Road X Slope (%)      | 4.6  | N/A  | Clear Space to XWalk (in)   | N/A  |  |
| N/A                                     | Any Obstructions?     | N/A  | N/A  | Storm Grate/Utility Hazard? | N/A  |  |
|   | Obstruction Type      |      |      | Storm Grate/Utility Type    |      |  |
|   |                       | N/A  |      |                             | N/A  |  |
|   |                       |      | Yes  | Surface Condition? (G/P)    | Good |  |