

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: WAVERLY_WALK_AV	Cross Street: HONEYMEADE_CIR	Location: NW
ADA ID: 9E112EC455A2	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 22.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

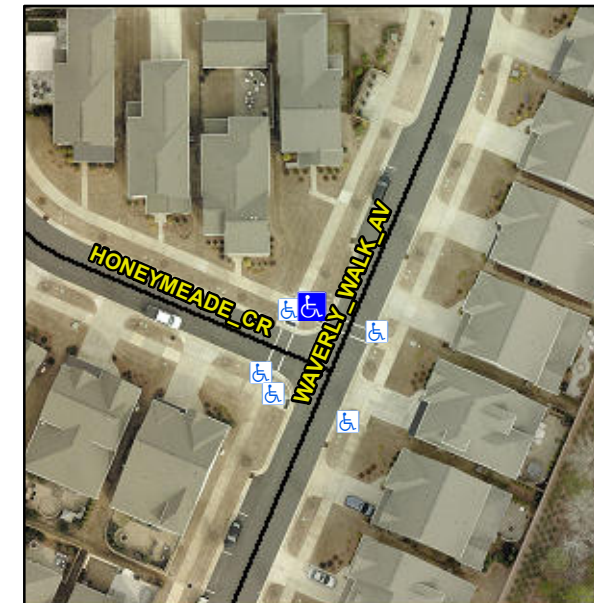

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.5.3, R304.2.2-Perp, R304.3.2-
Para, R304.5.2, R305.1.4, R305.2,
R302.7.2, R304.5.4**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	143.0	No	Grade Break?	No
Yes	Ramp Width (in)	70.0	N/A	Grade Break Slope (%)	4.8
Yes	Ramp Slope (%)	7.1	N/A	Grade Break XSlope (%)	0.2
No	Ramp XSlope (%)	2.6			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	71.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	70.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.8	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.9	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	5.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	12.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.4
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.5
N/A	Painted X Walk1?	No		Road Slope (%)	2.5
	X Walk 1 Direction	To SE		Road X Slope (%)	0.8
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.5	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.8	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	11.1

Street 1 Name	WAVERLY WALK AV
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

