

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

69.0

47.0

1.7

2.1

9.0

3.9

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Intersection ID: 52148 Main Street: OLD ARDREY KELL RD Cross Street: ARDREY PLACE DR Location: SW **Overall Compliance: No Severity Score:** 22.5 ADA ID: 9E1FA9D5C3AF Ramp Type: Combination1 Initial Pass/Fail: Fail

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

No

Yes

No

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp Slope (%)

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Flare Traversable RT?

Flare Type RT

Ramp XSlope RT (%)

Data

72.0

47.5

8.4

1.6

45.0 No

49.0 No

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A N/A

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)


Shared Landing?

Gutter Ponding?

Flare Traversable LT?

Flare Type LT

Ramp XSlope LT (%)

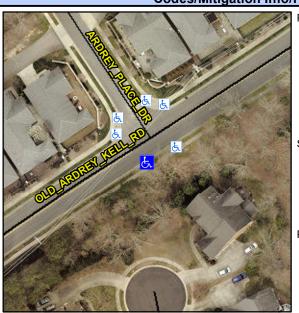

Street 1 Name None Stop Condition-Street 1 OLD ARDREY KELL RD Street 2 Name N/A Stop Condition-Street 2 N/A Possible Solutions: Compliance Description N/A Remove & Replace Entire Ramp. No No Yes N/A Yes Surveyor Notes: N/A RT RP < 5% N/A N/A N/A N/A PROW/ADA: N/A Not Found, R304.5.1, R304.2.2, N/A R304.5.3, R304.3.2 N/A N/A N/A





Total Cost:



1800.00

	_					
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A	
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	6.8		X Walk 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	N/A	
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
	Road Slope (%)	N/A		Clear Space?	N/A	
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
			N/A	Any Obstruction?	N/A	
				Obstruction Type		
To the same					N/A	
	A A		N/A	Storm Grate/Utility Hazard?	N/A	
				Storm Grate/Utility Type	N/A	
					N/A	
			Yes	Surface Condition? (G/P)	Good	
at act				Curb Slope (%)	11.6	
NAME OF TAXABLE PARTY.	100	,	-			