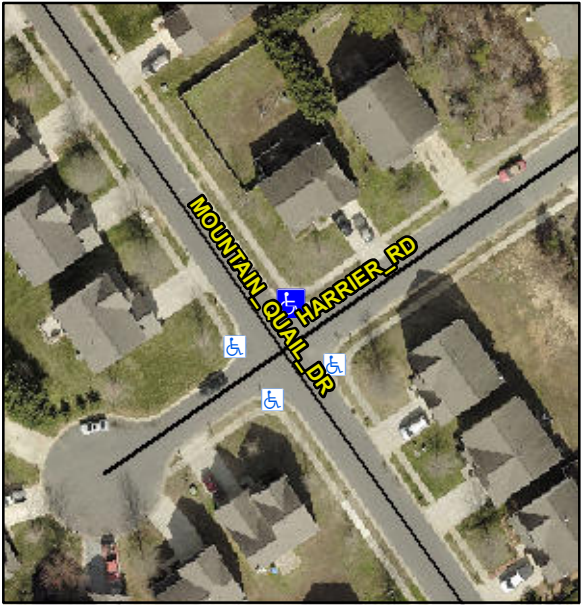


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 47909	Main Street: MOUNTAIN_QUAIL_DR	Cross Street: HARRIER_RD	Location:	N
ADA ID: 9E26A2E40D82	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 21.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
 Street 1 Name MOUNTAIN QUAIL DR Stop Condition-Street 2 None Street 2 Name HARRIER RD Stop Condition-Street 1 StopSign	Possible Solutions:	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			
	Surveyor Notes:	N/A			
	PROW/ADA:	Not Found, R304.5.1, R304.5.3			
	Total Cost:	\$ 3200.00			
			Compliance	Description	Data
			Yes	Ramp Length (in)	53.5
			No	Ramp Width (in)	38.5
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	No
			To SW	X Walk 1 Direction	To SE
			N/A	X Walk 1 Width (in)	N/A
			1.0	X Walk 1 Slope (%)	1.4
			2.2	X Walk 1 X Slope (%)	6.7
			N/A	Ramp inside XWalk1?	N/A
			6.6	Road Slope (%)	N/A
			1.0	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
			N/A	Obstruction Type	N/A
			N/A	Surface Condition? (G/P)	Good

