


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12305	Main Street: E_5TH_ST	Cross Street: N_COLLEGE_ST	Location: S
ADA ID: 9E49D0837665	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

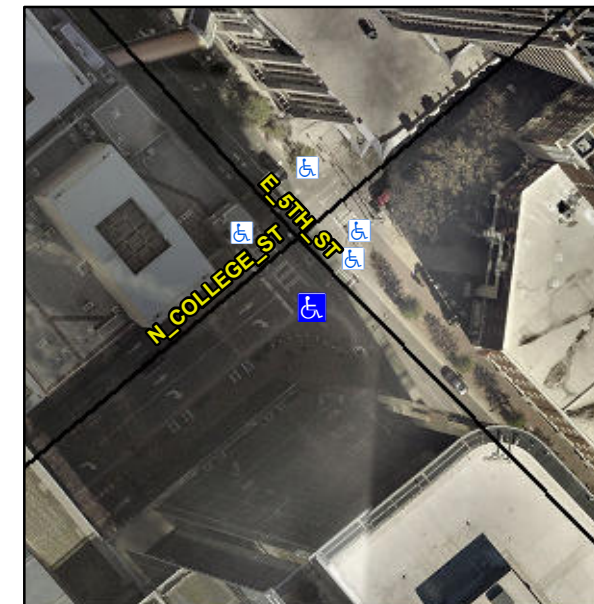

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk(s) To Provide Clear space.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3

Total Cost: \$ 3700.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	BlendTrans Slope (%)	0.7
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	4.4	Yes	Flare Slope RT (%)	8.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	2.0	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
	X Walk 1 Width (in)	108.0		X Walk 2 Width (in)	109.0
	X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	1.6
	X Walk 1 X Slope (%)	3.2		X Walk 2 X Slope (%)	0.1
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	2.3		Clear Space?	Yes
	Road X Slope (%)	2.4	No	Clear Space to XWalk (in)	24.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	8.1

Street 1 Name E 5TH ST
 Stop Condition-Street 1 Signal
 Street 2 Name N COLLEGE ST
 Stop Condition-Street 2 Signal

