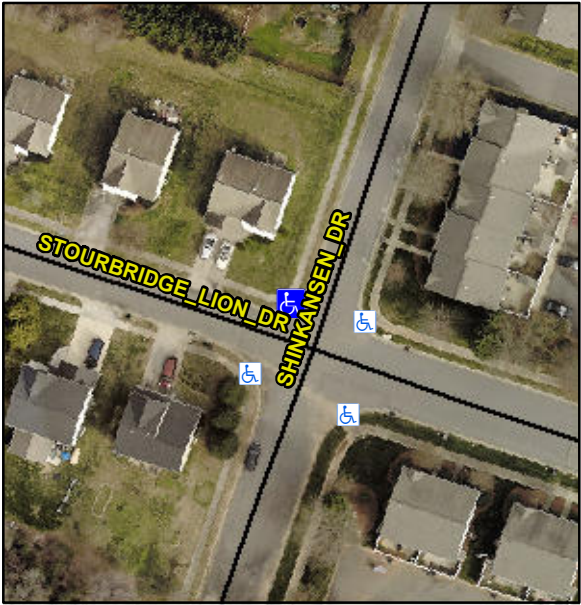


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30323	Main Street: SHINKANSEN_DR	Cross Street: STOURBRIDGE_LION_DR	Location: N
ADA ID: 9E7E42B14CE0	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	47.5	No	Ramp Slope (%)	14.4
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.2.2, R304.5.3</p>		No	Ramp Width (in)	38.5	No	Ramp XSlope (%)	7.0
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To W		X Walk 2 Direction	To E
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	0.3		X Walk 2 Slope (%)	5.4
			X Walk 1 X Slope (%)	6.1		X Walk 2 X Slope (%)	3.2
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	5.9	N/A	Clear Space?	N/A
			Road X Slope (%)	3.6	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
				N/A			N/A
					Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

