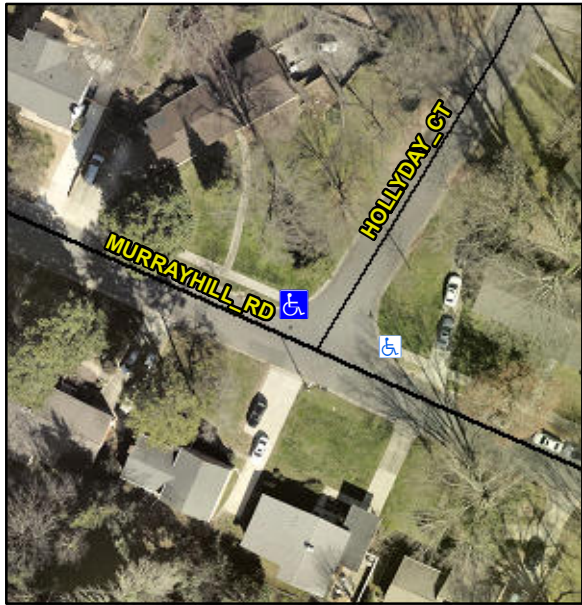


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 18483	Main Street: HOLLYDAY_CT	Cross Street: MURRAYHILL_RD	Location: NW
ADA ID: 9EB25DD6A1AF	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance																
	Possible Solutions:	Compliance			Description			Data	Compliance			Description			Data			
	Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	74.0	N/A	Grade Break?	N/A	N/A	Grade Break Slope (%)	0.0	N/A	Grade Break XSlope (%)	0.0					
		Yes	Ramp Width (in)	57.0	N/A	Flare Type LT	N/A	N/A	Flare Slope LT (%)	N/A	N/A	Flare Type RT	N/A	N/A	Flare Slope RT (%)	0.0		
		No	Ramp Slope (%)	10.7	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	N/A	DWS Provided?	N/A	N/A	DWS Contrast?	N/A		
		No	Ramp XSlope (%)	2.3	N/A	Landing Length (in)	0.0	N/A	Landing Width (in)	0.0	N/A	Landing Slope (%)	0.0	N/A	Landing X Slope (%)	0.0		
	Surveyor Notes:	N/A	N/A	Landing X Slope (%)	0.0	N/A	Landing Curb? (Y/N)	N/A	N/A	Shared Landing?	N/A	N/A	DWS Offset LT (in)	N/A	N/A	DWS Offset RT (in)	N/A	
		PROW/ADA:	R304.2.2, R304.5.3	N/A	Gutter Ponding?	0.0	N/A	Gutter Lip Ht (in)	0.0	N/A	Painted X Walk1?	No	N/A	Road Slope (%)	2.6	N/A	Road X Slope (%)	5.5
				X Walk 1 Direction	To E	N/A	X Walk 1 Width (in)	N/A	N/A	Clear Space?	N/A	N/A	Clear Space to XWalk (in)	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
				X Walk 1 Slope (%)	2.6	N/A	X Walk 1 X Slope (%)	5.5	N/A	Storm Grate/Utility Type		N/A	Storm Grate/Utility Type		N/A			
			Ramp inside XWalk1?	N/A	N/A	Any Obstructions?	N/A	N/A	Obstruction Type		Yes	Surface Condition? (G/P)	Good	N/A	Curb Slope (%)	8.2		
Total Cost:		\$	1600.00															

