


## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: 10019990 Main Street: ARMORY DR **Cross Street: N/A** Location: NE ADA ID: 9EDB19FF33B6 Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No** Severity Score: 13.75

**Codes/Mitigation Info/Possible Solution** 

## Field Measurements/Component Compliance

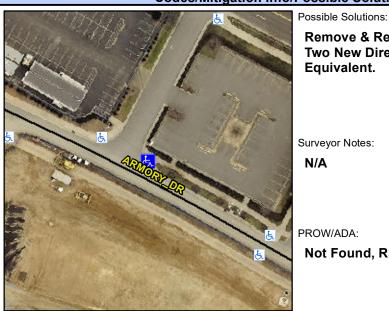

**ENTRANCE** Street 1 Name Stop Condition-Street 2 StopSign Street 2 Name **ARMORY DR** Stop Condition-Street 1 None

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes: N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

Total Cost: 3200.00

Comp	liance Description	Data	Compliance		Description	Data
N/A	Ramp Length (in)	55.0	No	Ramp	Slope (%)	10.0
Yes	Ramp Width (in)	48.0	No	Ramp	XSlope (%)	3.5
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutter	Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter	X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painte	ed X Walk2?	No
	X Walk 1 Direction	To NW		X Wal	k 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Wal	k 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.2		X Wal	k 2 Slope (%)	3.7
	X Walk 1 X Slope (%)	6.2		X Wal	k 2 X Slope (%)	0.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp	inside XWalk2?	N/A
	Road Slope (%)	3.3	N/A	Clear	Space?	N/A
	Road X Slope (%)	4.2	N/A	Clear	Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm	Grate/Utility Hazard?	N/A
	Obstruction Type			Storm	Grate/Utility Type	
		N/A				N/A

Yes

Surface Condition? (G/P)

Good





