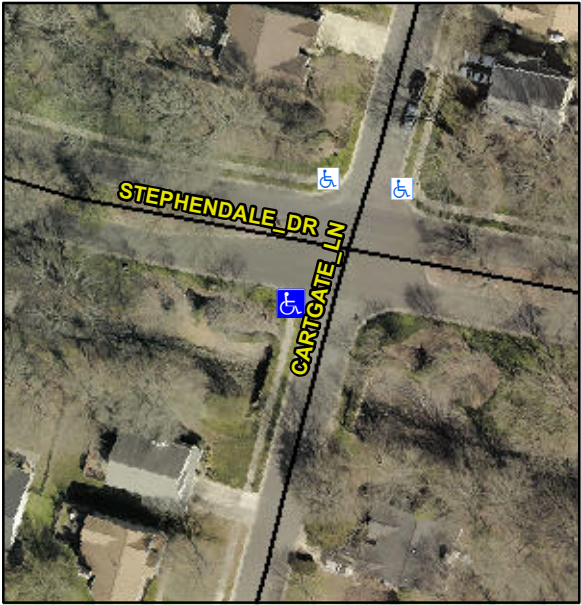


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 23899	Main Street: CARTGATE_LN	Cross Street: STEPHENDALE_DR	Location: SW
ADA ID: 9F3935FF57B1	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 21.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		<b>No</b>	Ramp Length (in)	<b>89.0</b>
			<b>No</b>	Ramp Width (in)	<b>45.0</b>
			<b>N/A</b>	Flare Type LT	<b>N/A</b>
			<b>N/A</b>	Flare Slope LT (%)	<b>N/A</b>
			<b>N/A</b>	Flare Traversable LT?	<b>N/A</b>
			<b>N/A</b>	Landing Length (in)	<b>N/A</b>
			<b>N/A</b>	Landing Width (in)	<b>N/A</b>
			<b>N/A</b>	Landing Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing Curb? (Y/N)	<b>N/A</b>
			<b>N/A</b>	Shared Landing?	<b>N/A</b>
			<b>N/A</b>	Gutter Ponding?	<b>N/A</b>
			<b>N/A</b>	Gutter Lip Ht (in)	<b>N/A</b>
			<b>No</b>	Painted X Walk1?	<b>No</b>
				X Walk 1 Direction	<b>To SE</b>
			<b>N/A</b>	X Walk 1 Width (in)	<b>N/A</b>
				X Walk 1 Slope (%)	<b>1.0</b>
				X Walk 1 X Slope (%)	<b>1.4</b>
			<b>N/A</b>	Ramp inside XWalk1?	<b>N/A</b>
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.1, R304.2.2</b></p>			<b>N/A</b>	Flare Type RT	<b>N/A</b>
			<b>N/A</b>	Flare Slope RT (%)	<b>N/A</b>
			<b>N/A</b>	Flare Traversable RT?	<b>N/A</b>
			<b>N/A</b>	DWS Provided?	<b>N/A</b>
			<b>N/A</b>	DWS Contrast?	<b>N/A</b>
			<b>N/A</b>	DWS Length (in)	<b>N/A</b>
			<b>N/A</b>	DWS Full Width?	<b>N/A</b>
			<b>N/A</b>	DWS Offset (in)	<b>N/A</b>
			<b>N/A</b>	Gutter Slope (%)	<b>N/A</b>
			<b>N/A</b>	Gutter X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Painted X Walk2?	<b>No</b>
				X Walk 2 Direction	<b>To NE</b>
			<b>N/A</b>	X Walk 2 Width (in)	<b>N/A</b>
				X Walk 2 Slope (%)	<b>3.7</b>
				X Walk 2 X Slope (%)	<b>0.1</b>
			<b>N/A</b>	Ramp inside XWalk2?	<b>N/A</b>
			<b>N/A</b>	Clear Space?	<b>N/A</b>
			<b>N/A</b>	Clear Space to XWalk (in)	<b>N/A</b>
			<b>N/A</b>	Storm Grate/Utility Hazard?	<b>N/A</b>
				Storm Grate/Utility Type	
			<b>N/A</b>		<b>N/A</b>
			<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>
Total Cost:		\$ 3200.00			

Street 1 Name **CARTGATE LN**

Stop Condition-Street 2 **StopSign**

Street 2 Name **STEPHENDALE DR**

Stop Condition-Street 1 **None**

