


Intersection ID: 10025677		Main Street: EAST_BV		Cross Street: N/A		Location:		SW	
ADA ID: 9F74C5B65927		Ramp Type: Perp		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 0	
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
		Possible Solutions:		Compliance		Description		Data	
		Remove & Replace Landing.		N/A		Ramp Length (in)		63.0	
				Yes		Ramp Width (in)		48.0	
				N/A		Flare Type LT		Sloped	
				N/A		Flare Slope LT (%)		1.0	
				N/A		Flare Traversable LT?		Yes	
				No		Landing Length (in)		35.0	
				Yes		Landing Width (in)		48.0	
				No		Landing Slope (%)		2.2	
				No		Landing X Slope (%)		2.6	
Surveyor Notes:  N/A		PROW/ADA:		N/A		Landing Curb? (Y/N)		Yes	
				N/A		Shared Landing?		No	
				Yes		Gutter Ponding?		No	
				Yes		Gutter Lip Ht (in)		0.0	
				N/A		Painted X Walk1?		Yes	
						X Walk 1 Direction		To NE	
				N/A		X Walk 1 Width (in)		114.0	
						X Walk 1 Slope (%)		4.0	
						X Walk 1 X Slope (%)		2.5	
				Yes		Ramp inside XWalk1?		Yes	
Total Cost: \$ 500.00				N/A		Road Slope (%)		N/A	
				N/A		Road X Slope (%)		N/A	
				Yes		Any Obstructions?		No	
						Obstruction Type			
								N/A	
								Yes	
								Surface Condition? (G/P)	
								Good	

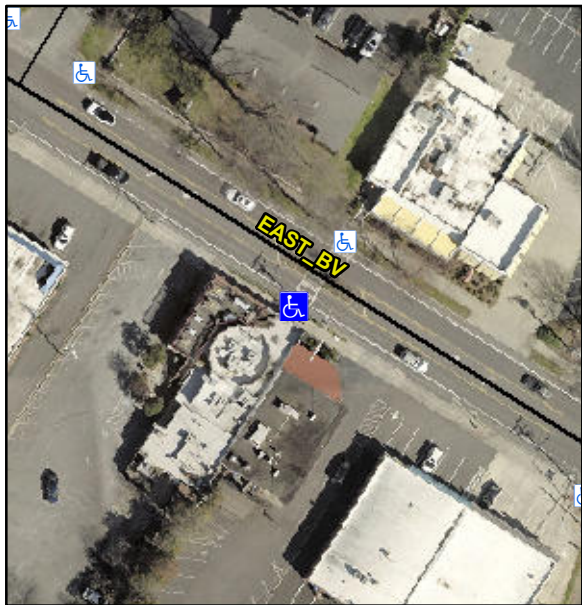