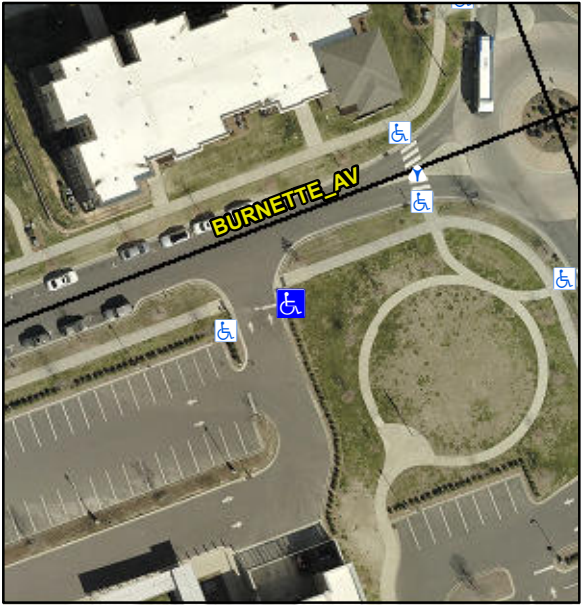


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10022154	Main Street: BURNETTE_AV	Cross Street: N/A	Location: SE
ADA ID: 9FEEA24E98DD	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:	Remove & Replace Entire Ramp.					
	Surveyor Notes:	N/A					
	PROW/ADA:	R304.2.2, R304.5.3					
	Street 1 Name	ENTRANCE					
	Stop Condition-Street 1	StopSign					
	Street 2 Name	N/A					
	Stop Condition-Street 2	N/A					
			Compliance	Description	Data	Compliance	Description
			N/A	Ramp Length (in)	175.0	N/A	Grade Break?
			Yes	Ramp Width (in)	72.0	N/A	Grade Break Slope (%)
			No	Ramp Slope (%)	10.5	N/A	Grade Break XSlope (%)
			No	Ramp XSlope (%)	2.6		
			N/A	Flare Type LT	N/A	N/A	Flare Type RT
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?
			N/A	Landing Length (in)	0.0	N/A	DWS Provided?
			N/A	Landing Width (in)	0.0	N/A	DWS Contrast?
			N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)
			N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)
			N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)
			N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)
			N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)
			N/A	Painted X Walk1?	No		Road Slope (%)
				X Walk 1 Direction	To SW		Road X Slope (%)
				X Walk 1 Width (in)	N/A		Clear Space?
				X Walk 1 Slope (%)	6.6	N/A	Clear Space to XWalk (in)
				X Walk 1 X Slope (%)	2.7	N/A	Storm Grate/Utility Hazard?
			N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type
			N/A	Any Obstructions?	N/A		
				Obstruction Type		Yes	Surface Condition? (G/P)
						N/A	Curb Slope (%)
Total Cost:		\$ 1600.00					

