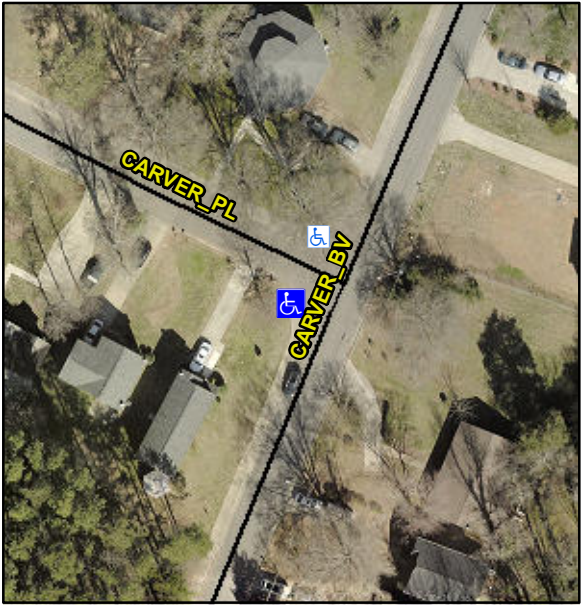


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 5462	Main Street: CARVER_BV	Cross Street: CARVER_PL	Location: W
ADA ID: A0193C26C95E	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 30

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>N/A</b>	Ramp Length LT (in)	<b>66.0</b>
			<b>No</b>	Ramp Width LT (in)	<b>35.0</b>
			<b>Yes</b>	Ramp Slope LT (%)	<b>6.0</b>
			<b>Yes</b>	Ramp XSlope LT (%)	<b>1.1</b>
			<b>N/A</b>	Landing Length (in)	<b>N/A</b>
			<b>N/A</b>	Landing Width (in)	<b>N/A</b>
			<b>N/A</b>	Landing Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing Curb? (Y/N)	<b>N/A</b>
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>R304.5.1, R304.3.2</b></p>			<b>N/A</b>	Ramp XSlope RT (%)	<b>1.2</b>
			<b>N/A</b>	DWS Provided?	<b>N/A</b>
			<b>N/A</b>	DWS Contrast?	<b>N/A</b>
			<b>N/A</b>	DWS Length (in)	<b>N/A</b>
			<b>N/A</b>	DWS Full Width?	<b>N/A</b>
			<b>N/A</b>	DWS Offset (in)	<b>N/A</b>
			<b>N/A</b>	Gutter Slope (%)	<b>N/A</b>
			<b>N/A</b>	Gutter X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Painted X Walk1?	<b>No</b>
			<b>N/A</b>	X Walk 1 Direction	<b>To NE</b>
			<b>N/A</b>	X Walk 1 Width (in)	<b>N/A</b>
				X Walk 1 Slope (%)	<b>4.6</b>
				X Walk 1 X Slope (%)	<b>1.9</b>
			<b>N/A</b>	Ramp inside XWalk1?	<b>N/A</b>
				Road Slope (%)	<b>N/A</b>
				Road X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Any Obstructions?	<b>N/A</b>
				Obstruction Type	
			<b>N/A</b>	Storm Grate/Utility Hazard?	<b>N/A</b>
				Storm Grate/Utility Type	
Total Cost:		<b>\$ 1600.00</b>	<b>N/A</b>		<b>N/A</b>
			<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>
			<b>N/A</b>	Curb Slope (%)	<b>19.3</b>

