

## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 43098Main Street: HOPEDALE\_AVCross Street: QUEENS\_RD\_WESTLocation:NEADA ID: A0604254B8B6Ramp Type: PerpInitial Pass/Fail: FailOverall Compliance: NoSeverity Score: 26.25

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance




Street 1 Name	GRANVILLE RD
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Possible Solutions:	
Remove & Replace Entire Ramp.	ı
	•
	ı
	ı
	ı
	l
Surveyor Notes:	
N/A	
	l
PROW/ADA:	
Not Found, R304.2.2, R304.5.3	

N/A			
N/A			
	Total Cost:		

Compliance Description		Data		iance Description	Data
N/A	Ramp Length (in)	72.0	No	Ramp Slope (%)	12.9
Yes	Ramp Width (in)	48.0	No	No Ramp XSlope (%)	
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	7.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type		l	Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good



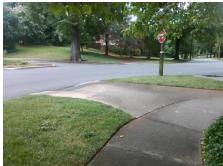



1850.00