

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 14844	Main Street: DILWORTH_RD_WEST	Cross Street: EAST_BV	Location: SW
ADA ID: A0AAD6CFDFCC	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

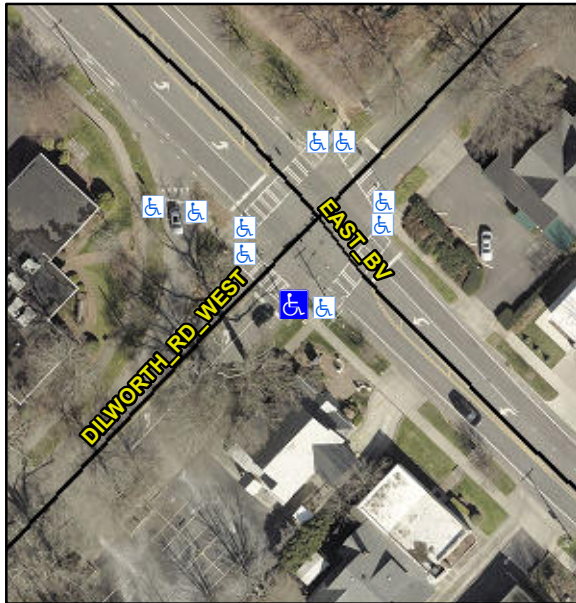

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3**

Street 1 Name	<b>DILWORTH RD WEST</b>
Stop Condition-Street 1	<b>Signal</b>
Street 2 Name	<b>N/A</b>
Stop Condition-Street 2	<b>N/A</b>

Total Cost: \$ **1600.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	40.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	73.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	3.5	N/A	Grade Break XSlope (%)	0.0
No	Ramp XSlope (%)	2.5			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	50.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	73.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.8	Yes	DWS Length (in)	25.5
No	Landing X Slope (%)	2.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	8.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	Yes		Road Slope (%)	4.2
	X Walk 1 Direction	To NW		Road X Slope (%)	0.9
	X Walk 1 Width (in)	107.0		Clear Space?	Yes
	X Walk 1 Slope (%)	4.2	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.9	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.0

