


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10040553		Main Street: W_7TH_ST		Cross Street: N/A		Location: E							
ADA ID: A1E809F49159		Ramp Type: Directional2		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 12.5					
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance									
				Possible Solutions:		Compliance		Description		Data			
				Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	53.0		N/A	Grade Break?	N/A	
						Yes	Ramp Width (in)	58.0		N/A	Grade Break Slope (%)	0.0	
						Yes	Ramp Slope (%)	6.0		N/A	Grade Break XSlope (%)	0.0	
						No	Ramp XSlope (%)	6.6					
						N/A	Flare Type LT	N/A		N/A	Flare Type RT	N/A	
						N/A	Flare Slope LT (%)	N/A		N/A	Flare Slope RT (%)	0.0	
				Surveyor Notes:		N/A	Flare Traversable LT?	N/A		N/A	Flare Traversable RT?	N/A	
						N/A	Landing Length (in)	0.0		N/A	DWS Provided?	N/A	
						N/A	Landing Width (in)	0.0		N/A	DWS Contrast?	N/A	
				N/A	Landing Slope (%)	0.0		N/A	DWS Length (in)	N/A			
				N/A	Landing X Slope (%)	0.0		N/A	DWS Full Width?	N/A			
				N/A	Landing Curb? (Y/N)	N/A		N/A	DWS Offset LT (in)	N/A			
				N/A	Shared Landing?	N/A		N/A	DWS Offset RT (in)	N/A			
				N/A	Gutter Ponding?	0.0		N/A	Gutter Slope (%)	N/A			
				N/A	Gutter Lip Ht (in)	0.0		N/A	Gutter X Slope (%)	N/A			
				N/A	Painted X Walk1?	No			Road Slope (%)	2.4			
					X Walk 1 Direction	To NW			Road X Slope (%)	0.3			
					X Walk 1 Width (in)	N/A			Clear Space?	N/A			
					X Walk 1 Slope (%)	2.4		N/A	Clear Space to XWalk (in)	N/A			
					X Walk 1 X Slope (%)	0.3		N/A	Storm Grate/Utility Hazard?	N/A			
				N/A	Ramp inside XWalk1?	N/A			Storm Grate/Utility Type				
				N/A	Any Obstructions?	N/A				N/A			
					Obstruction Type			Yes	Surface Condition? (G/P)	Good			
								N/A	Curb Slope (%)	13.0			
				Street 1 Name		W 7TH ST							
				Stop Condition-Street 1		None							
				Street 2 Name		N/A							
				Stop Condition-Street 2		N/A							
				Total Cost:		\$ 1800.00							

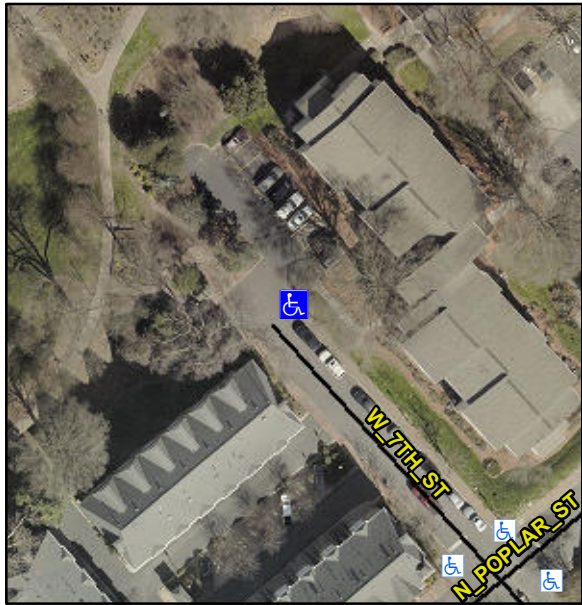