

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10077	Main Street: E_35TH_ST	Cross Street: N_DAVIDSON_ST	Location: SW
ADA ID: A1F69E2AC3F5	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 20	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

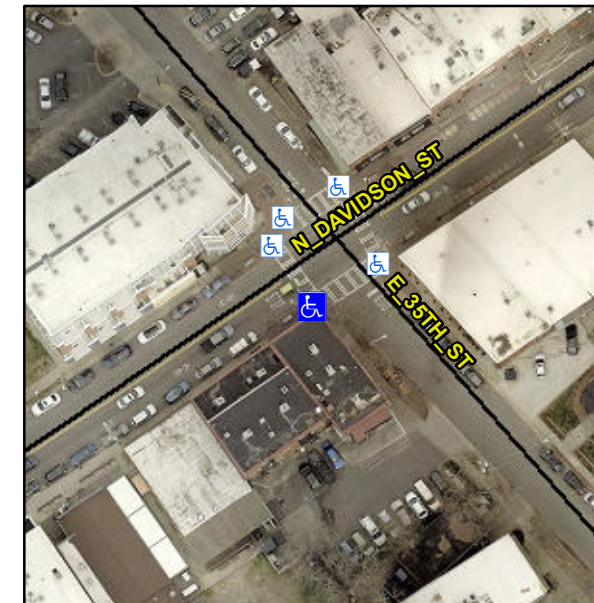

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.3, R302.7.2, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	25.0	Yes	BlendTrans Slope (%)	1.2
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
No	Flare Slope LT (%)	N/A	No	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.5
N/A	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.9
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
	X Walk 1 Width (in)	113.0		X Walk 2 Width (in)	80.0
	X Walk 1 Slope (%)	6.5		X Walk 2 Slope (%)	2.9
	X Walk 1 X Slope (%)	4.3		X Walk 2 X Slope (%)	3.0
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.6		Clear Space?	Yes
	Road X Slope (%)	6.1	Yes	Clear Space to XWalk (in)	57.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	3.6

Street 1 Name E 35TH ST
 Stop Condition-Street 1 StopSign
 Street 2 Name N DAVIDSON ST
 Stop Condition-Street 2 StopSign

