


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10037210	Main Street: SANDY_ROCK_PL	Cross Street: N/A	Location: E
ADA ID: A27E9F0C4C61	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

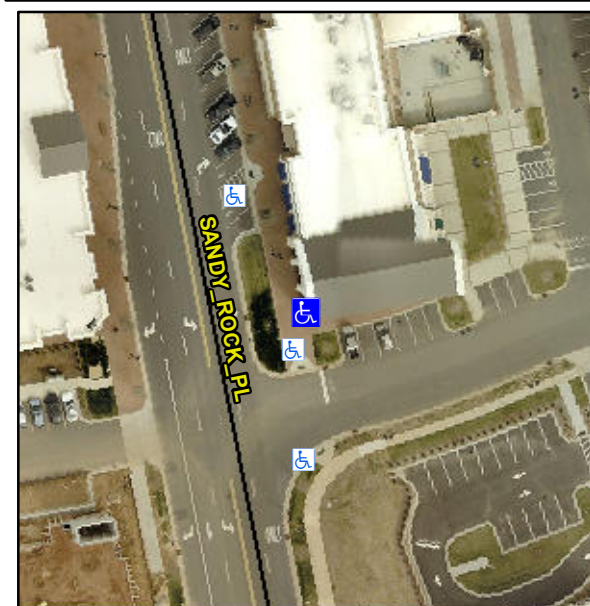

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.3

Total Cost: \$ 1850.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	77.0	Yes	Ramp Slope (%)	7.6
Yes	Ramp Width (in)	60.0	Yes	Ramp XSlope (%)	0.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.7	No	Flare Slope RT (%)	10.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.1	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	3.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	5.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name	SAND ROCK PL
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

