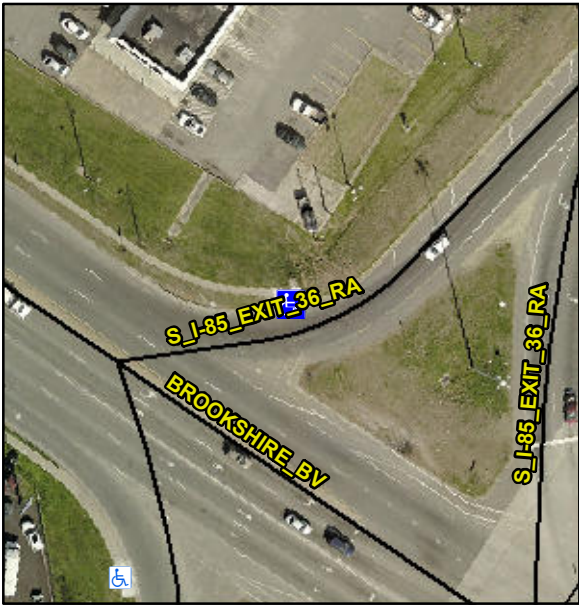


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 8333	Main Street: BROOKSHIRE_BV	Cross Street: S_I-85_EXIT_36_RA	Location: NE
ADA ID: A28BB4431C13	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	54.0	No	Ramp Slope (%)	10.3
			No	Ramp Width (in)	42.0	Yes	Ramp XSlope (%)	0.1
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:	N/A		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
	PROW/ADA:		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
	Not Found, R304.5.1, R304.2.2		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	55.0	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	6.4		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A	N/A	Clear Space?	N/A	
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$ 1850.00						

