

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12618	Main Street: E_5TH_ST	Cross Street: N_CALDWELL_ST	Location: NE
ADA ID: A29702C2F951	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 37.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

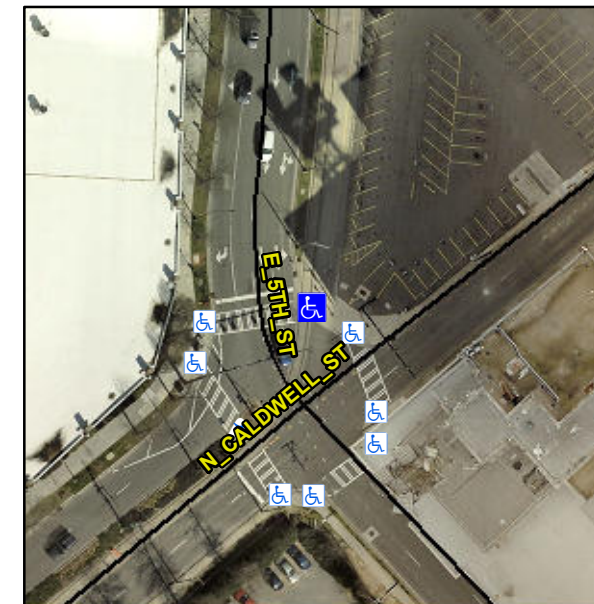

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip. Relocate Obstruction.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.1.4, R302.7.2, R302.3, R402.2

Total Cost: \$ 4400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	82.0	Yes	BlendTrans Slope (%)	2.4
Yes	Ramp Width (in)	80.0	No	BlendTrans XSlope (%)	2.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	2.7	Yes	Flare Slope RT (%)	4.9
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	25.0
N/A	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.4
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	121.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.7		Clear Space?	Yes
	Road X Slope (%)	4.6	N/A	Clear Space to XWalk (in)	N/A
No	Any Obstructions?	Yes	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
				CDOT VAULT 0.5	N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	0.6

