

Access Compliance Report Public Rights-of-Way (Curb Ramps)



N/A

0.4

Good

Surface Condition? (G/P)

Curb Slope (%)


Intersection ID: N/A Main Street: STONEWALL_ST Cross Street: ALEXANDER_ST Location: W

ADA ID: A35637E647D2	2 Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Complia	nce: Yes	Severity Score:	0
	Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance				
	Possible Solutions:	Compliance De	scription Data	Data Compliance Description		Data
	N/A	N/A Ramp Lei	ngth (in) 70.0	Yes	Grade Break?	Yes
		Yes Ramp Wi	dth (in) 118.0	Yes	Grade Break Slope (%)	4.3
		Yes Ramp Slo	pe (%) 5.4	Yes	Grade Break XSlope (%)	0.0
	R. T.	Yes Ramp XS	ope (%) 0.7			
11: - 11: (3)		Yes Flare Typ	e LT N/A	Yes	Flare Type RT	N/A
		N/A Flare Slop	pe LT (%) N/A	N/A	Flare Slope RT (%)	N/A
i the i	Surveyor Notes:	N/A Flare Trav	rersable LT? No	N/A	Flare Traversable RT?	No
	N/A	Yes Landing L	ength (in) 48.0	Yes	DWS Provided?	Yes
and the state of t		Yes Landing V	Vidth (in) 48.0	Yes	DWS Contrast?	Yes
all thinks I was a second	d.	Yes Landing S	lope (%) 0.5	Yes	DWS Length (in)	24.0
THE PERSON NAMED IN COLUMN TWO IS NOT THE PERSON NAMED IN COLUMN TWO IS NAM		Yes Landing X	Slope (%) 0.5	Yes	DWS Full Width?	Yes
O MEAN	PROW/ADA:	N/A Landing C	urb? (Y/N) N/A	Yes	DWS Offset LT (in)	55.5
3	N/A	N/A Shared La	anding? No	Yes	DWS Offset RT (in)	1.0
		Yes Gutter Po	nding? No	Yes	Gutter Slope (%)	0.0
6		Yes Gutter Lip	Ht (in) 0.0	Yes	Gutter X Slope (%)	0.4
		N/A Painted X	Walk1? No		Road Slope (%)	1.3
Street 1 Name	S ALEXANDER ST	X Walk 1	Direction To SE		Road X Slope (%)	1.8
Stop Condition-Street 1	StopSign	X Walk 1	Width (in) N/A		Clear Space?	Yes
Street 2 Name	N/A	X Walk 1	Slope (%) 1.3	N/A	Clear Space to XWalk (in)	N/A
Stop Condition-Street 2	N/A	X Walk 1	X Slope (%) 1.8	Yes	Storm Grate/Utility Hazard?	No
		N/A Ramp ins	de XWalk1? N/A		Storm Grate/Utility Type	





Total Cost:

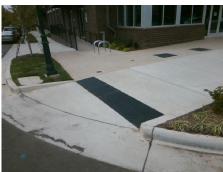

Yes

0.00

Any Obstructions?

Obstruction Type

No

N/A Yes