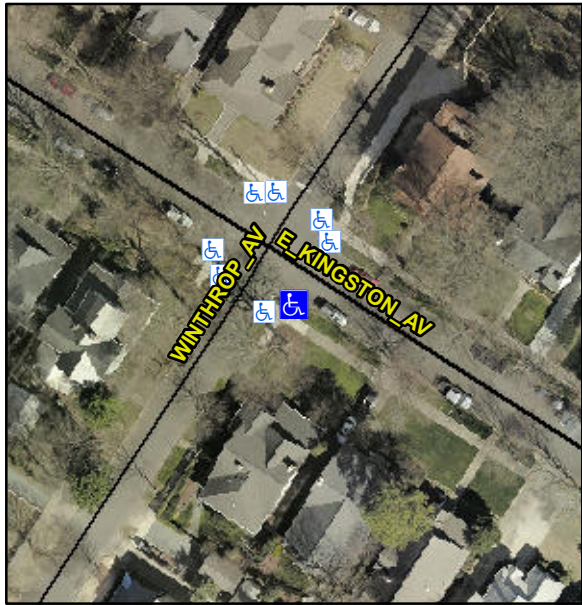


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14366	Main Street: E_KINGSTON_AV	Cross Street: WINTHROP_AV	Location: S
ADA ID: A38FCB65457C	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 25.25			

	Possible Solutions:				
	Remove & Replace Entire Ramp. Grind Gutter Lip.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	R304.5.3, R304.2.2-Perp, R304.3.2- Para, R305, R302.7, R302.7.2				
	Street 1 Name		E KINGSTON AV		
	Stop Condition-Street 2		None		
	Street 2 Name		N/A		
	Stop Condition-Street 1		N/A		
Total Cost:		\$	2050.00		

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	89.0	Yes	Ramp Slope (%)	7.4
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	12.1	N/A	Flare Slope RT (%)	14.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	70.0	No	DWS Provided?	No
Yes	Landing Width (in)	58.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	4.1	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.5	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	4.0
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

