

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

51.0

59.0

0.6 0.3 3.3

6.6

N/A N/A

N/A N/A N/A

N/A

N/A N/A

N/A

N/A

No

To N

N/A 2.1 6.5

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Good


13.5

Intersection ID: N/A Main Street: GENERAL_DR Cross Street: WESTERN_RIDGE_RD Location: SW

ADA ID: A3CF88A995EB Ramp Type: Combination1Diag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

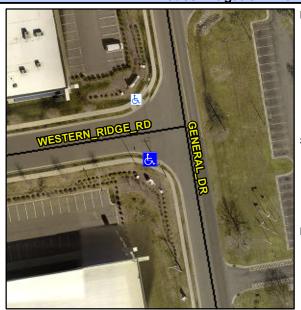

Street 1 Name
Stop Condition-Street 1
Street 2 Name
Stop Condition-Street 2

None GENERAL DR StopSign WESTERN RIDGE RD Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

Not Found, R304.5.3, R304.3.2

Total Cost:

Compli	ance Description	Data	Compli	ance	Description
N/A	Ramp Length LT (in)	64.0	N/A	Ramp	Length RT (in)
Yes	Ramp Width LT (in)	48.0	Yes	Ramp	Width RT (in)
No	Ramp Slope LT (%)	10.0	Yes	Ramp	Slope RT (%)
Yes	Ramp XSlope LT (%)	0.6	Yes	Ramp	XSlope RT (%)
N/A	Ramp Length (in)	52.0	Yes	Ramp	Slope (%)
Yes	Ramp Width (in)	48.0	No	Ramp	XSlope (%)
N/A	Flare Type LT	N/A	N/A	Flare	Type RT
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)
N/A	Painted X Walk1?	No	N/A	Paint	ed X Walk2?
	X Walk 1 Direction	То Е		X Wa	lk 2 Direction
	X Walk 1 Width (in)	N/A		X Wa	lk 2 Width (in)
	X Walk 1 Slope (%)	5.6		X Wa	lk 2 Slope (%)
	X Walk 1 X Slope (%)	0.1		X Wa	lk 2 X Slope (%)
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp	inside XWalk2?

4.7

N/A

N/A

N/A

Yes

Clear Space?

Any Obstruction?

Obstruction Type

Curb Slope (%)

Clear Space to XWalk (in)

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

Surface Condition? (G/P)







Road Slope (%)

3200.00