

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52442	Main Street: WOODWARD_AV	Cross Street: BENDING_BIRCH_PL	Location: W
ADA ID: A402F4F6FD52	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 20.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

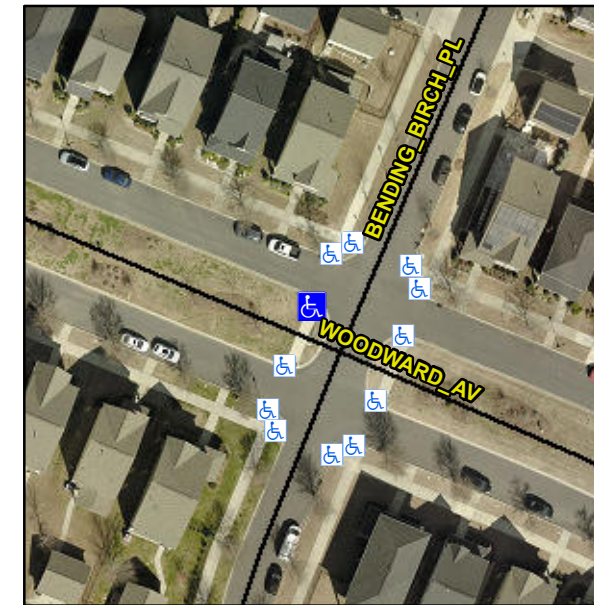

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

LOCATED ON MEDIAN

PROW/ADA:

R304.5.3, R302.7.2, R304.5.4

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	85.5	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	60.0	No	Grade Break Slope (%)	5.4
Yes	Ramp Slope (%)	7.0	Yes	Grade Break XSlope (%)	3.3
Yes	Ramp XSlope (%)	2.1			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.3	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	13.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	8.0
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	3.4
N/A	Painted X Walk1?	No		Road Slope (%)	2.3
	X Walk 1 Direction	To N		Road X Slope (%)	5.2
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	5.2	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.3

Street 1 Name	WOODWARD AV
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

