


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 31896Main Street: GREEN_MOUNTAIN_RDCross Street: SHOPTON_RD_WESTLocation:NWADA ID: A40CC0DB7E6FRamp Type: PerpDiagInitial Pass/Fail: FailOverall Compliance: NoSeverity Score:10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

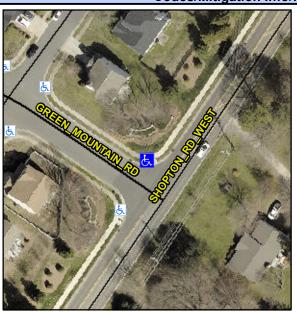

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

GREEN MOUNTAIN RD StopSign SHOPTON RD WEST None Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Total Cost: \$ 3200.00

r leid Measurements/Component Compnance						
	Comp	Compliance Description		Comp	liance Description	Data
	N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.3
	No	Ramp Width (in)	47.0	No	Ramp XSlope (%)	2.8
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
	N/A	Shared Landing?	N/A			
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
		X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	1.2
		X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	2.0
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	3.0	N/A	Clear Space?	N/A
		Road X Slope (%)	1.3	N/A	Clear Space to XWalk (in)	N/A
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		Obstruction Type			Storm Grate/Utility Type	
			N/A			N/A

Yes

Surface Condition? (G/P)

Good





