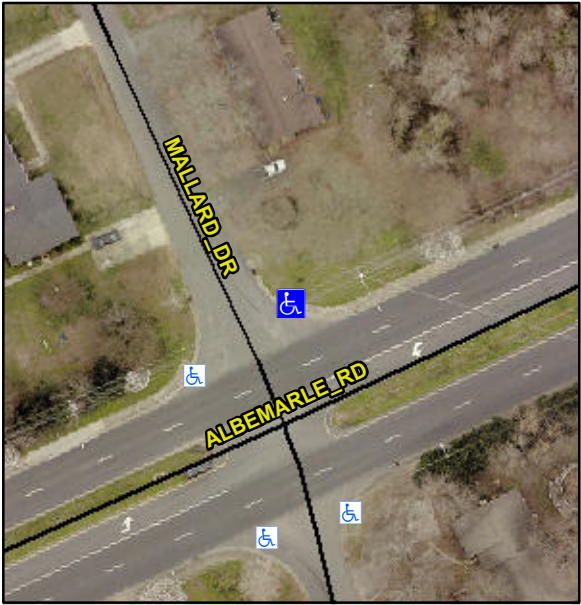


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14779	Main Street: ALBEMARLE_RD	Cross Street: MALLARD_DR	Location: NE
ADA ID: A43509E1E28B	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
 <p>Street 1 Name MALLARD DR</p> <p>Stop Condition-Street 2 StopSign</p> <p>Street 2 Name ALBEMARLE RD</p> <p>Stop Condition-Street 1 None</p>	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		No	Ramp Length (in)	59.0
			Yes	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	N/A
			To W	X Walk 1 Direction	To S
			N/A	X Walk 1 Width (in)	N/A
			1.9	X Walk 1 Slope (%)	1.6
			0.5	X Walk 1 X Slope (%)	2.4
			N/A	Ramp inside XWalk1?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.2.2</p> <p>Total Cost: \$ 3200.00</p>			N/A	Ramp inside XWalk2?	N/A
			0.4	Road Slope (%)	N/A
			1.9	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

