

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



N/A

N/A

N/A

N/A


N/A

Good

Main Street: OAKTON HUNT DR **Cross Street: WRAYHILL DR** Location: Intersection ID: 31202 Ν Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No** 22.5 ADA ID: A46F7E64D2AD **Severity Score:** 

**Codes/Mitigation Info/Possible Solution** 

## Field Measurements/Component Compliance

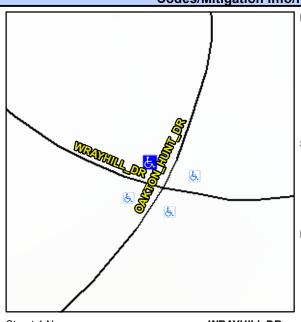

Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1

WRAYHILL DR StopSign **OAKTON HUNT DR** StopSign

Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.1, R304.2.2, R304.5.3

Total Cost: 3200.00

Compli	iance Description	Data	Compl	iance	Description	Data
N/A	Ramp Length (in)	70.0	No	Ram	o Slope (%)	9.6
No	Ramp Width (in)	38.0	No	Ramp	xSlope (%)	4.5
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutte	er Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	er X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Paint	ed X Walk2?	No
	X Walk 1 Direction	To SW		X Wa	lk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	ılk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.7		X Wa	ılk 2 Slope (%)	3.2
	X Walk 1 X Slope (%)	3.0		X Wa	ılk 2 X Slope (%)	9.8

N/A

N/A

N/A

N/A

Yes

N/A

2.6

1.6

N/A

N/A

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Storm Grate/Utility Hazard?

Clear Space?







N/A

N/A

Ramp inside XWalk1?

Road Slope (%)

Road X Slope (%)

Any Obstructions?

**Obstruction Type**