


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 5272	Main Street: CHINEMIST_CT	Cross Street: FROSTMOR_PL	Location: NE
ADA ID: A505ED10FA1C	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 48.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

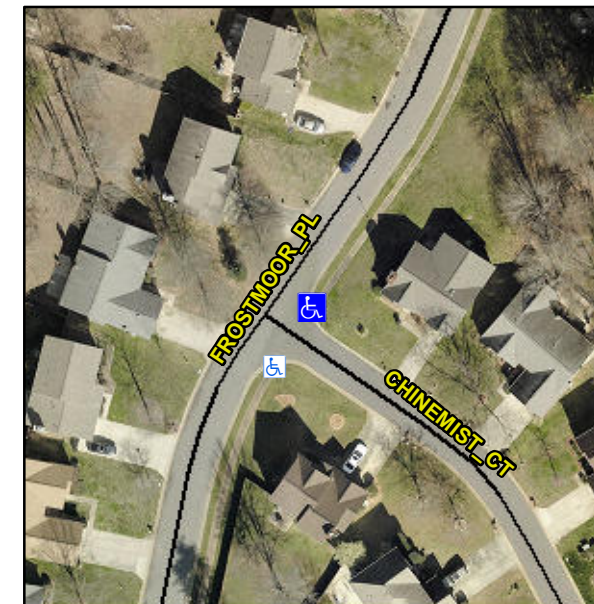

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.1, R304.2.2, R302.7

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	26.0	N/A	Grade Break?	N/A
No	Ramp Width (in)	43.0	N/A	Grade Break Slope (%)	0.0
No	Ramp Slope (%)	20.0	N/A	Grade Break XSlope (%)	0.0
Yes	Ramp XSlope (%)	0.6			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No		Road Slope (%)	7.1
	X Walk 1 Direction	To W		Road X Slope (%)	0.2
	X Walk 1 Width (in)	N/A		Clear Space?	N/A
	X Walk 1 Slope (%)	7.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.2	N/A	Storm Grate/Utility Hazard?	N/A
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
N/A	Any Obstructions?	N/A			N/A
	Obstruction Type		No	Surface Condition? (G/P)	Poor
			N/A	Curb Slope (%)	7.8

Street 1 Name CHINEMIST CT
 Stop Condition-Street 1 StopSign
 Street 2 Name N/A
 Stop Condition-Street 2 N/A

