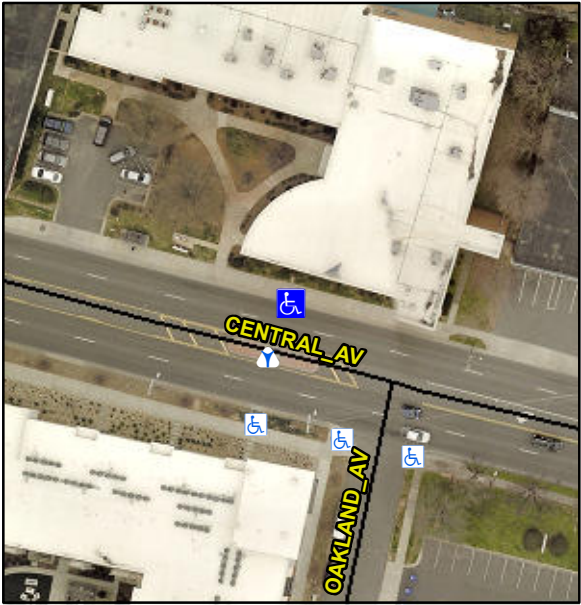


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12962	Main Street: CENTRAL_AV	Cross Street: OAKLAND_AV	Location:	N
ADA ID: A51331E79277	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 12.5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	69.0
			Yes	Ramp Width LT (in)	89.0
			No	Ramp Slope LT (%)	8.7
			Yes	Ramp XSlope LT (%)	1.2
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.3.2</p>			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To S
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	0.5
				X Walk 1 X Slope (%)	1.2
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	N/A
<p>Street 1 Name</p> <p>CENTRAL AV</p> <p>Stop Condition-Street 1</p> <p>None</p> <p>Street 2 Name</p> <p>N/A</p> <p>Stop Condition-Street 2</p> <p>N/A</p>			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
<p>Total Cost:</p> <p>\$ 1600.00</p>			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	14.1

