


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 7249	Main Street: HIDDEN_FOREST_DR	Cross Street: TOM_HUNTER_RD	Location: SE
ADA ID: A52FD8526F99	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 33.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

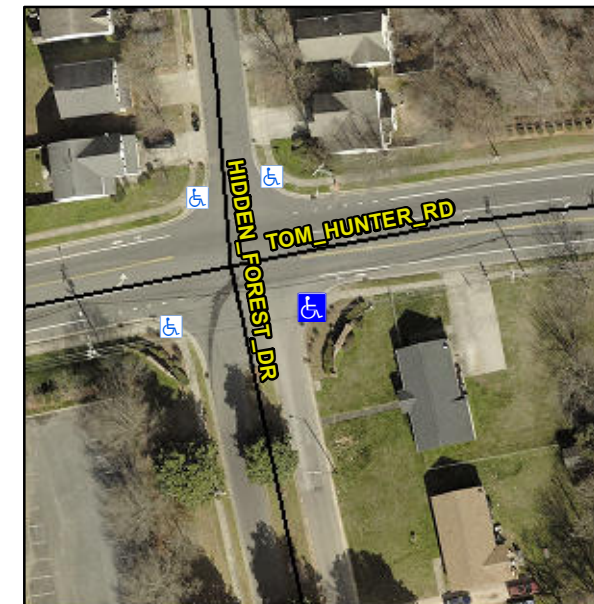

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**NO RT SW, RT RP < 5%**

PROW/ADA:

**R304.5.1, R304.3.2, R304.5.3**

Street 1 Name **TOM HUNTER RD**  
 Stop Condition-Street 1 **None**  
 Street 2 Name **HIDDEN FOREST DR**  
 Stop Condition-Street 2 **StopSign**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	61.5	N/A	Ramp Length RT (in)	75.0
No	Ramp Width LT (in)	47.5	Yes	Ramp Width RT (in)	61.0
No	Ramp Slope LT (%)	8.9	Yes	Ramp Slope RT (%)	1.6
No	Ramp XSlope LT (%)	6.1	No	Ramp XSlope RT (%)	6.6
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	1.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	0.8
	X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	3.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.1	N/A	Clear Space?	N/A
	Road X Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	30.2

