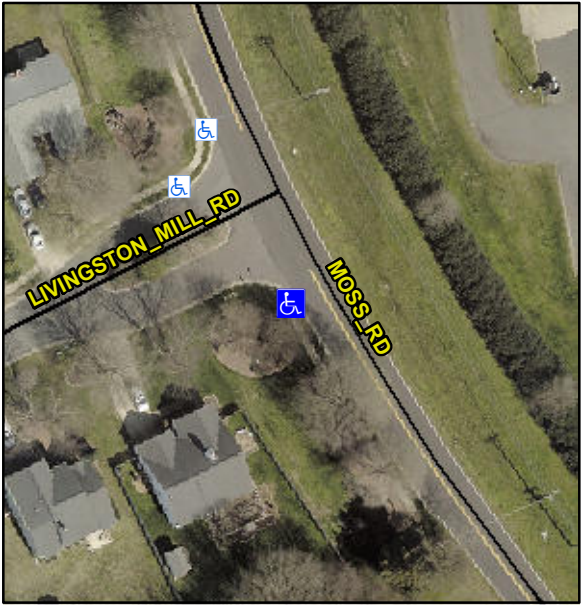


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 24079	Main Street: LIVINGSTON_MILL_RD	Cross Street: MOSS_RD	Location: SW
ADA ID: A53C35523CBE	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:						
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	6.1
		Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.9
		N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	1.7	N/A	Flare Slope RT (%)	2.6
		N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
		No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
		No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
		No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
		No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.2</p>		N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.0
		N/A	Shared Landing?	No			
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.0
		Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.5
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	5.9		X Walk 2 Slope (%)	0.6
			X Walk 1 X Slope (%)	1.0		X Walk 2 X Slope (%)	4.6
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
<p>Street 1 Name</p> <p>Stop Condition-Street 2</p> <p>Street 2 Name</p> <p>Stop Condition-Street 1</p>			Road Slope (%)	4.0	N/A	Clear Space?	Yes
			Road X Slope (%)	5.7	N/A	Clear Space to XWalk (in)	N/A
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good
Total Cost:		\$	3200.00				

