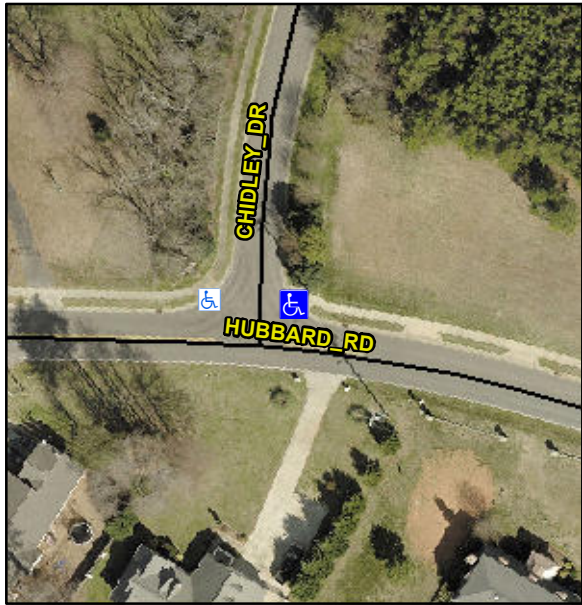


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                       |                         |                          |                        |
|-----------------------|-------------------------|--------------------------|------------------------|
| Intersection ID: 5243 | Main Street: CHIDLEY_DR | Cross Street: HUBBARD_RD | Location: NE           |
| ADA ID: A548A4D419BC  | Ramp Type: Perp         | Initial Pass/Fail: Fail  | Overall Compliance: No |
|                       |                         |                          | Severity Score: 13.75  |

| Codes/Mitigation Info/Possible Solution  |                               |     | Field Measurements/Component Compliance |                       |      |                             |                       |      |
|--|-------------------------------|-----|---|-----------------------|------|-----------------------------|-----------------------|------|
|  | Possible Solutions:           |     | Compliance                              | Description           | Data | Compliance                  | Description           | Data |
|  | Remove & Replace Entire Ramp. |     | N/A                                     | Ramp Length (in)      | 48.0 | No                          | Ramp Slope (%)        | 10.5 |
|  |                               |     | Yes                                     | Ramp Width (in)       | 48.0 | No                          | Ramp XSlope (%)       | 2.2  |
|  |                               |     | N/A                                     | Flare Type LT         | N/A  | N/A                         | Flare Type RT         | N/A  |
|  |                               |     | N/A                                     | Flare Slope LT (%)    | N/A  | N/A                         | Flare Slope RT (%)    | N/A  |
|  |                               |     | N/A                                     | Flare Traversable LT? | N/A  | N/A                         | Flare Traversable RT? | N/A  |
|  |                               |     | N/A                                     | Landing Length (in)   | N/A  | N/A                         | DWS Provided?         | N/A  |
|  |                               |     | N/A                                     | Landing Width (in)    | N/A  | N/A                         | DWS Contrast?         | N/A  |
|  |                               |     | N/A                                     | Landing Slope (%)     | N/A  | N/A                         | DWS Length (in)       | N/A  |
|  |                               |     | N/A                                     | Landing X Slope (%)   | N/A  | N/A                         | DWS Full Width?       | N/A  |
| Surveyor Notes:  | N/A                           |     | N/A                                     | Landing Curb? (Y/N)   | N/A  | N/A                         | DWS Offset (in)       | N/A  |
|  |                               |     | N/A                                     | Shared Landing?       | N/A  |                             |                       |      |
|  | PROW/ADA:                     |     | N/A                                     | Gutter Ponding?       | N/A  | N/A                         | Gutter Slope (%)      | N/A  |
|  | Not Found, R304.2.2, R304.5.3 |     | N/A                                     | Gutter Lip Ht (in)    | N/A  | N/A                         | Gutter X Slope (%)    | N/A  |
|  |                               |     | N/A                                     | Painted X Walk1?      | No   | N/A                         | Painted X Walk2?      | N/A  |
|  |                               |     |   | X Walk 1 Direction    | To W |                             | X Walk 2 Direction    | N/A  |
|  |                               |     | N/A                                     | X Walk 1 Width (in)   | N/A  | N/A                         | X Walk 2 Width (in)   | N/A  |
|  |                               |     |   | X Walk 1 Slope (%)    | 2.7  |                             | X Walk 2 Slope (%)    | N/A  |
|  |                               |     |   | X Walk 1 X Slope (%)  | 1.8  |                             | X Walk 2 X Slope (%)  | N/A  |
|  |                               |     | N/A                                     | Ramp inside XWalk1?   | N/A  | N/A                         | Ramp inside XWalk2?   | N/A  |
|  |                               |     | Road Slope (%)                          | N/A                   | N/A  | Clear Space?                | N/A                   |      |
|  |                               |     | Road X Slope (%)                        | N/A                   | N/A  | Clear Space to XWalk (in)   | N/A                   |      |
|  |                               | N/A | Any Obstructions?                       | N/A                   | N/A  | Storm Grate/Utility Hazard? | N/A                   |      |
|  |                               |     | Obstruction Type                        |                       |      | Storm Grate/Utility Type    |                       |      |
|  |                               |     |   | N/A                   |      |                             | N/A                   |      |
|  |                               |     |   |                       | Yes  | Surface Condition? (G/P)    | Good                  |      |
| Total Cost:  |                               | \$  | 1850.00                                 |                       |      |                             |                       |      |

