


Intersection ID: 10027126		Main Street: GARDEN_TR		Cross Street: N/A		Location:		W							
ADA ID: A6307964F064		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 13.75							
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance											
 <p>Street 1 Name</p> <p>ENTRANCE</p> <p>Stop Condition-Street 1</p> <p>StopSign</p> <p>Street 2 Name</p> <p>N/A</p> <p>Stop Condition-Street 2</p> <p>N/A</p>				Possible Solutions:		Remove & Replace Entire Ramp.									
				Surveyor Notes:		N/A									
				PROW/ADA:		R304.2.2, R304.5.3									
				Compliance		Description		Data		Compliance		Description		Data	
				N/A		Ramp Length (in)		70.0		N/A		Grade Break?		N/A	
				Yes		Ramp Width (in)		48.0		N/A		Grade Break Slope (%)		0.0	
				No		Ramp Slope (%)		11.3		N/A		Grade Break XSlope (%)		0.0	
				No		Ramp XSlope (%)		2.7							
				N/A		Flare Type LT		N/A		N/A		Flare Type RT		N/A	
				N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		0.0	
N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A					
N/A		Landing Length (in)		0.0		N/A		DWS Provided?		N/A					
N/A		Landing Width (in)		0.0		N/A		DWS Contrast?		N/A					
N/A		Landing Slope (%)		0.0		N/A		DWS Length (in)		N/A					
N/A		Landing X Slope (%)		0.0		N/A		DWS Full Width?		N/A					
N/A		Landing Curb? (Y/N)		N/A		N/A		DWS Offset LT (in)		N/A					
N/A		Shared Landing?		N/A		N/A		DWS Offset RT (in)		N/A					
N/A		Gutter Ponding?		0.0		N/A		Gutter Slope (%)		N/A					
N/A		Gutter Lip Ht (in)		0.0		N/A		Gutter X Slope (%)		N/A					
N/A		Painted X Walk1?		Yes				Road Slope (%)		0.3					
		X Walk 1 Direction		To N				Road X Slope (%)		0.3					
		X Walk 1 Width (in)		54.0				Clear Space?		N/A					
		X Walk 1 Slope (%)		0.3		N/A		Clear Space to XWalk (in)		N/A					
		X Walk 1 X Slope (%)		0.3		N/A		Storm Grate/Utility Hazard?		N/A					
N/A		Ramp inside XWalk1?		Yes				Storm Grate/Utility Type							
N/A		Any Obstructions?		N/A						N/A					
		Obstruction Type				Yes		Surface Condition? (G/P)		Good					
						N/A		N/A		Curb Slope (%)		11.4			
Total Cost:				\$		1600.00									

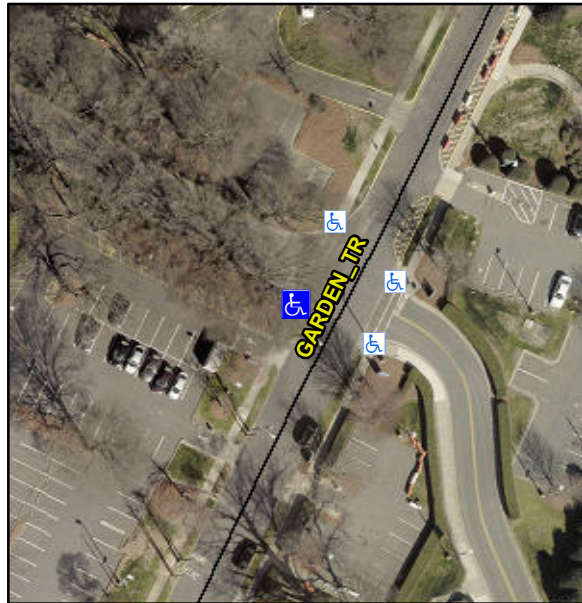