

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 47569	Main Street: ROWE_CT	Cross Street: HERMSLEY_RD	Location:	N
ADA ID: A67ACCAB7649	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

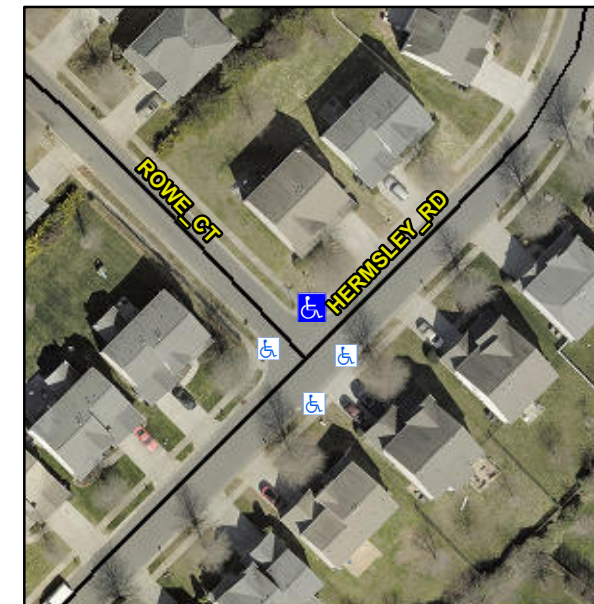

Possible Solutions:

**Remove & Replace Landing.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-
Para, R304.5.4**

Total Cost: \$ 1250.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	47.5	Yes	BlendTrans Slope (%)	3.9
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.4	N/A	Flare Slope RT (%)	2.2
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	47.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.2		X Walk 2 Slope (%)	1.4
	X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	3.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.1		Clear Space?	Yes
	Road X Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	4.7

Street 1 Name ROWE CT
Stop Condition-Street 1 StopSign
Street 2 Name HERMSLEY RD
Stop Condition-Street 2 None

