

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30236	Main Street: HELMS_RD	Cross Street: LEECREST_DR	Location:	N
ADA ID: A69100F1B035	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

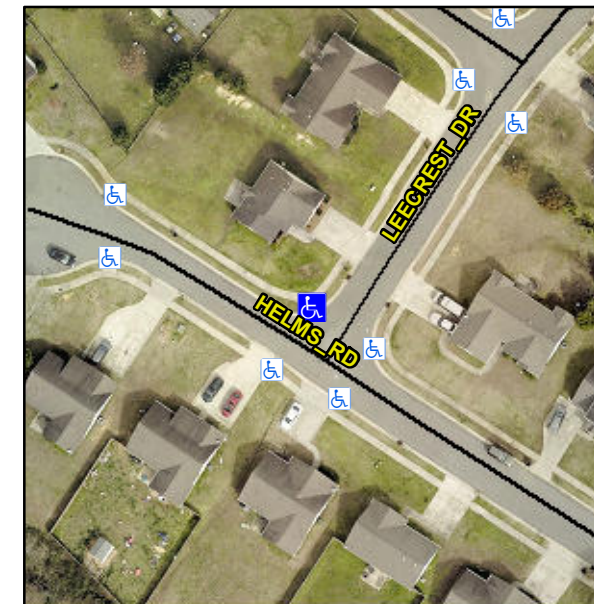

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

CURB LIP 2.0

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R305, R302.7, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	46.0	Yes	BlendTrans Slope (%)	1.1
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	2.6	N/A	Flare Slope RT (%)	4.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	5.8	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.3	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	14.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	0.7
	X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	0.5
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.0		Clear Space?	Yes
	Road X Slope (%)	1.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	2.1

Street 1 Name **HELMS RD**
 Stop Condition-Street 1 **None**
 Street 2 Name **LEECREST DR**
 Stop Condition-Street 2 **StopSign**

