


Intersection ID: 18066	Main Street: CHARMAPEG_AV	Cross Street: LYTTLETON_DR	Location:	NW
ADA ID: A7252EAD9D56	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 37.5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance								
	Possible Solutions:		Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			Compliance	Description	Data	Compliance	Description	Data
						N/A	Ramp Length (in)	49.0	No	Ramp Slope (%)	9.0
						Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	7.6
						N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
						N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
						N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
						N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
						N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
						N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
						N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:		N/A			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
PROW/ADA:		Not Found, R304.2.2, R304.5.3			N/A	Shared Landing?	N/A				
					N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
					N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
					N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
						X Walk 1 Direction	To SW		X Walk 2 Direction	To SE	
					N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
						X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	8.2	
						X Walk 1 X Slope (%)	7.8		X Walk 2 X Slope (%)	2.0	
Street 1 Name		CHARMAPEG AV			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
Stop Condition-Street 2		StopSign				Road Slope (%)	5.9	N/A	Clear Space?	N/A	
Street 2 Name		LYTTLETON DR				Road X Slope (%)	7.6	N/A	Clear Space to XWalk (in)	N/A	
Stop Condition-Street 1		StopSign			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
						Obstruction Type			Storm Grate/Utility Type		
							N/A			N/A	
								Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$ 3200.00									

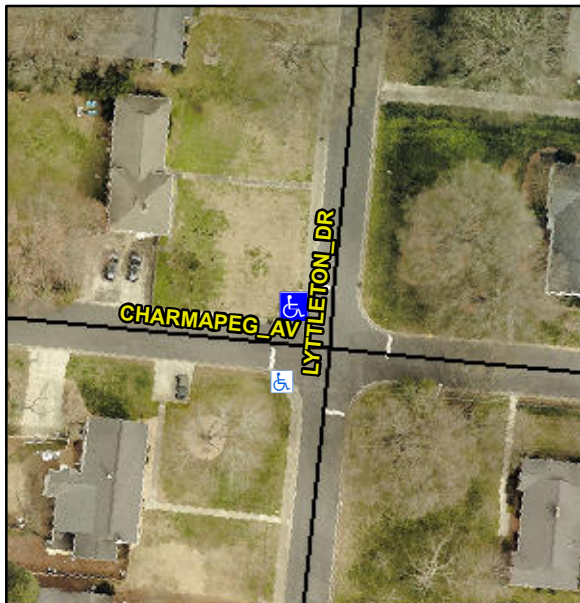