


Intersection ID: 23898		Main Street: LONGHEDGE_LN		Cross Street: MOSS_RD		Location:		NW									
ADA ID: A77A3176252F		Ramp Type: PerpDiag		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 13.75									
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance													
 <div>Street 1 NameLONGHEDGE LN</div> <div>Stop Condition-Street 2StopSign</div> <div>Street 2 NameMOSS RD</div> <div>Stop Condition-Street 1None</div>				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data	
				Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A		Ramp Length (in)		48.0		No		Ramp Slope (%)		11.0	
						Yes		Ramp Width (in)		48.0		No		Ramp XSlope (%)		3.7	
						N/A		Flare Type LT		N/A		N/A		Flare Type RT		N/A	
						N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		N/A	
						N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A	
				Surveyor Notes: N/A		N/A		Landing Length (in)		N/A		N/A		DWS Provided?		N/A	
						N/A		Landing Width (in)		N/A		N/A		DWS Contrast?		N/A	
						N/A		Landing Slope (%)		N/A		N/A		DWS Length (in)		N/A	
						N/A		Landing X Slope (%)		N/A		N/A		DWS Full Width?		N/A	
N/A		Landing Curb? (Y/N)				N/A		N/A		DWS Offset (in)		N/A					
PROW/ADA: Not Found, R304.2.2, R304.5.3		N/A		Shared Landing?		N/A											
		N/A		Gutter Ponding?		N/A		N/A		Gutter Slope (%)		N/A					
		N/A		Gutter Lip Ht (in)		N/A		N/A		Gutter X Slope (%)		N/A					
		N/A		Painted X Walk1?		No		N/A		Painted X Walk2?		No					
				X Walk 1 Direction		To S				X Walk 2 Direction		To E					
		N/A		X Walk 1 Width (in)		N/A		N/A		X Walk 2 Width (in)		N/A					
				X Walk 1 Slope (%)		1.0				X Walk 2 Slope (%)		4.4					
				X Walk 1 X Slope (%)		2.6				X Walk 2 X Slope (%)		0.9					
		N/A		Ramp inside XWalk1?		N/A		N/A		Ramp inside XWalk2?		N/A					
				Road Slope (%)		1.4		N/A		Clear Space?		N/A					
		Road X Slope (%)		3.0		N/A		Clear Space to XWalk (in)		N/A							
		N/A		Any Obstructions?		N/A		N/A		Storm Grate/Utility Hazard?		N/A					
				Obstruction Type						Storm Grate/Utility Type							
						N/A				N/A							
								Yes		Surface Condition? (G/P)		Good					
Total Cost:		\$ 3200.00															

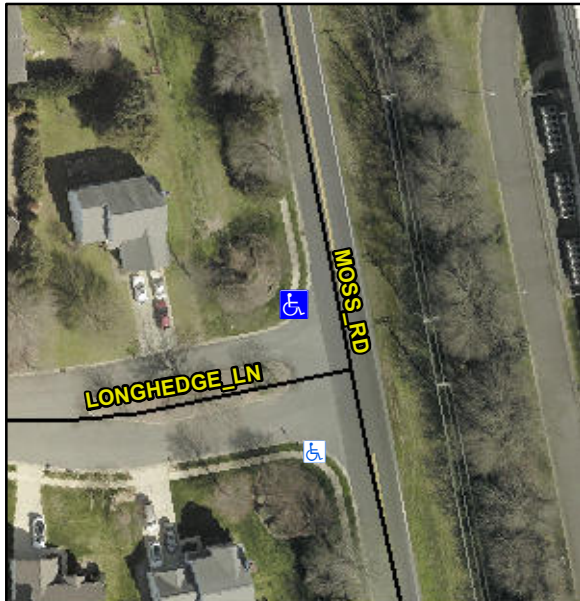