


Intersection ID: 10026312	Main Street: FAIRVIEW_RD	Cross Street: N/A	Location:	SW
ADA ID: A824E5B70F93	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

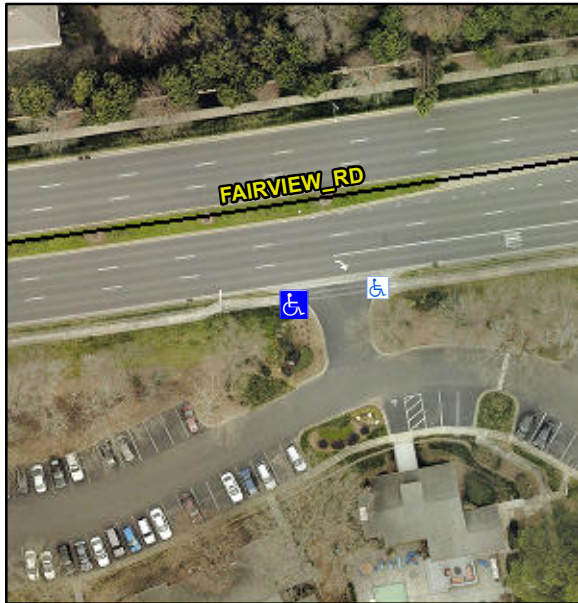

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.5.3, R304.3.2

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	60.0	N/A	Ramp Length RT (in)	61.0
Yes	Ramp Width LT (in)	59.0	Yes	Ramp Width RT (in)	59.0
Yes	Ramp Slope LT (%)	4.9	No	Ramp Slope RT (%)	9.9
No	Ramp XSlope LT (%)	2.1	No	Ramp XSlope RT (%)	2.1
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.0		X Walk 2 Slope (%)	5.2
	X Walk 1 X Slope (%)	6.4		X Walk 2 X Slope (%)	1.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	5.2	N/A	Clear Space?	N/A
	Road X Slope (%)	4.9	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	0.3

Total Cost: \$ 3200.00

Yes	Surface Condition? (G/P)	Good
N/A	Curb Slope (%)	0.3

Yes	Surface Condition? (G/P)	Good
N/A	Curb Slope (%)	0.3

