

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 31596	Main Street: TUMBLEWEED_CT	Cross Street: WINDY_VALLEY_DR	Location: S
ADA ID: A8321F78061B	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.75	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

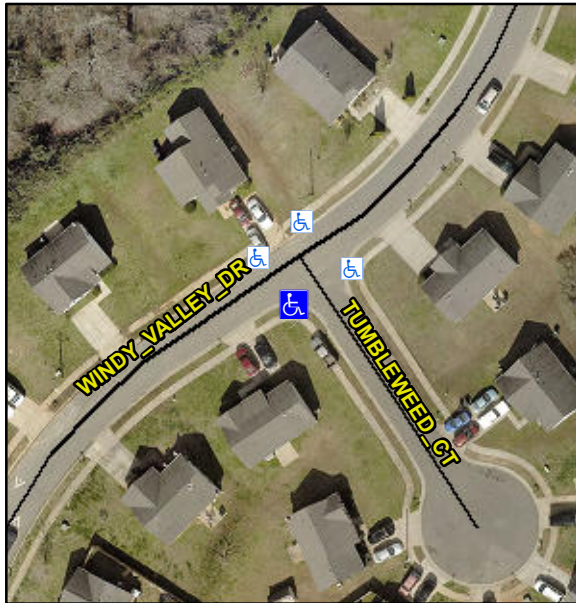

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305.1.4, R305.2

Street 1 Name **TUMBLEWEED CT**
 Stop Condition-Street 1 **StopSign**
 Street 2 Name **WINDY VALLEY DR**
 Stop Condition-Street 2 **None**

Total Cost: \$ **3950.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	52.5	Yes	BlendTrans Slope (%)	3.9
Yes	Ramp Width (in)	54.0	No	BlendTrans XSlope (%)	4.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	8.5	N/A	Flare Slope RT (%)	2.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.8
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.6
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.0		X Walk 2 Slope (%)	4.4
	X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	5.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.2		Clear Space?	Yes
	Road X Slope (%)	3.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	5.1

