

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49656	Main Street: SKYLINE_VIEW_WY	Cross Street: SEIGLE_POINT_DR	Location: SW
ADA ID: A907A828E468	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

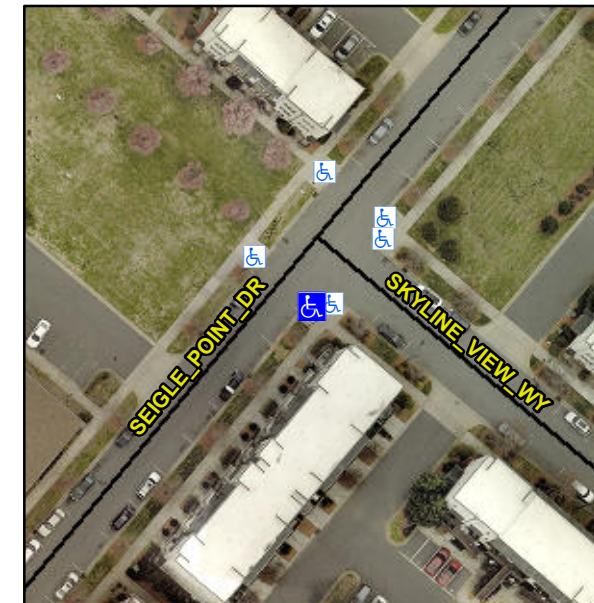

Possible Solutions:

**Remove & Replace Landing.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R302.7, R304.5.4

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	67.5	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	72.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	3.8	N/A	Grade Break XSlope (%)	0.0
Yes	Ramp XSlope (%)	0.7			
Yes	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	5.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	112.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.8	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	2.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	8.0
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	5.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.0
N/A	Painted X Walk1?	No		Road Slope (%)	2.5
	X Walk 1 Direction	To NW		Road X Slope (%)	0.6
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.5	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.6	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.7

Total Cost: \$ 1250.00

Street 1 Name	SEIGLE POINT DR
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

