


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11265	Main Street: N_TRYON_ST	Cross Street: WADSWORTH_PL	Location: S
ADA ID: A97A143D4C4B	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

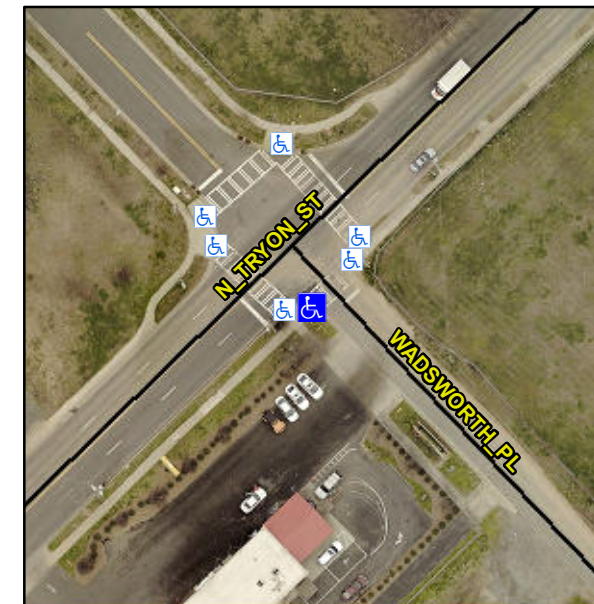

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305.2, R302.7

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	110.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	59.5	Yes	Grade Break Slope (%)	0.9
Yes	Ramp Slope (%)	1.3	Yes	Grade Break XSlope (%)	1.1
Yes	Ramp XSlope (%)	0.3			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	59.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	59.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.4	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	16.0
N/A	Shared Landing?	Yes	No	DWS Offset RT (in)	4.0
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	1.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	Yes		Road Slope (%)	0.6
	X Walk 1 Direction	To NE		Road X Slope (%)	3.8
	X Walk 1 Width (in)	118.5		Clear Space?	Yes
	X Walk 1 Slope (%)	0.6	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.8	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	10.8

