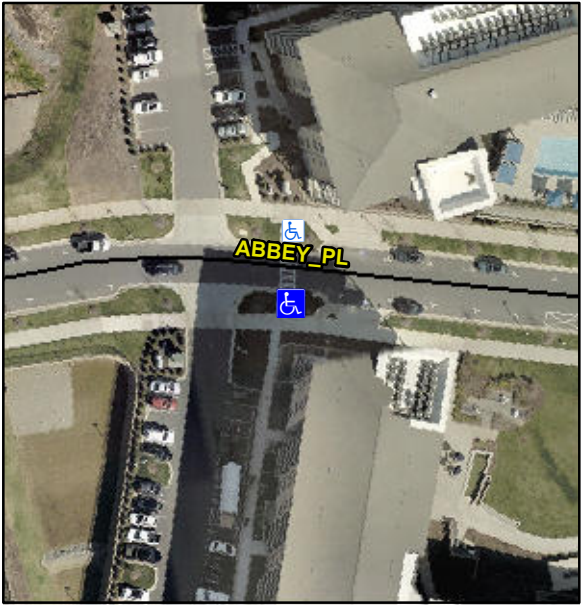


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10019281	Main Street: ABBEY_PL	Cross Street: N/A	Location: S
ADA ID: A9EBA87F75E0	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	62.0
			Yes	Ramp Width (in)	57.0
			Yes	Flare Type L	Curbed_NoWalkSurface
			Yes	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	No
			Yes	Landing Length (in)	96.0
			Yes	Landing Width (in)	96.0
			Yes	Landing Slope (%)	1.9
			Yes	Landing X Slope (%)	0.8
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.3, R305</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	No
			No	DWS Provided?	No
			N/A	DWS Contrast?	No
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	No
			N/A	DWS Offset (in)	N/A
			No	Gutter Ponding?	No
			Yes	Gutter Lip Ht (in)	0.0
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To E
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	1.1
				X Walk 1 X Slope (%)	0.7
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			Yes	Any Obstructions?	No
				Obstruction Type	
Total Cost:			\$	1850.00	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

